

DEWALT®

English

8

한국어

19

Fig. A1
그림 A1

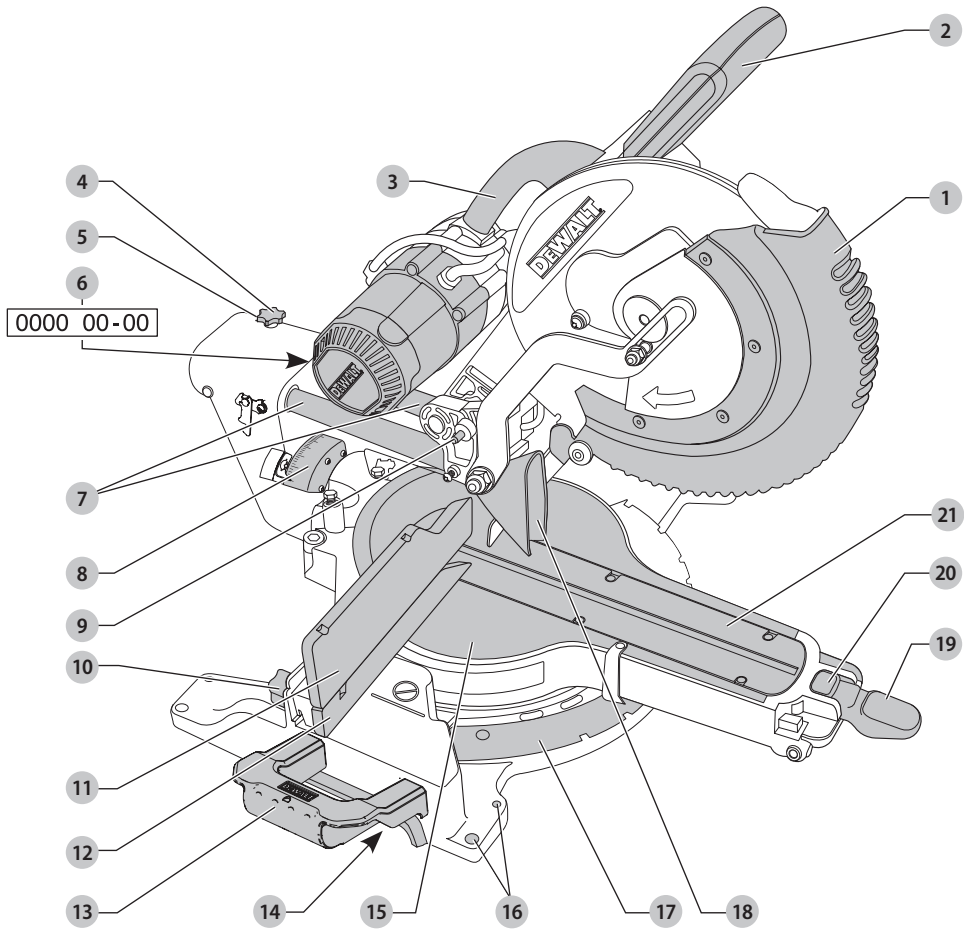


Fig. A2
그림 A2

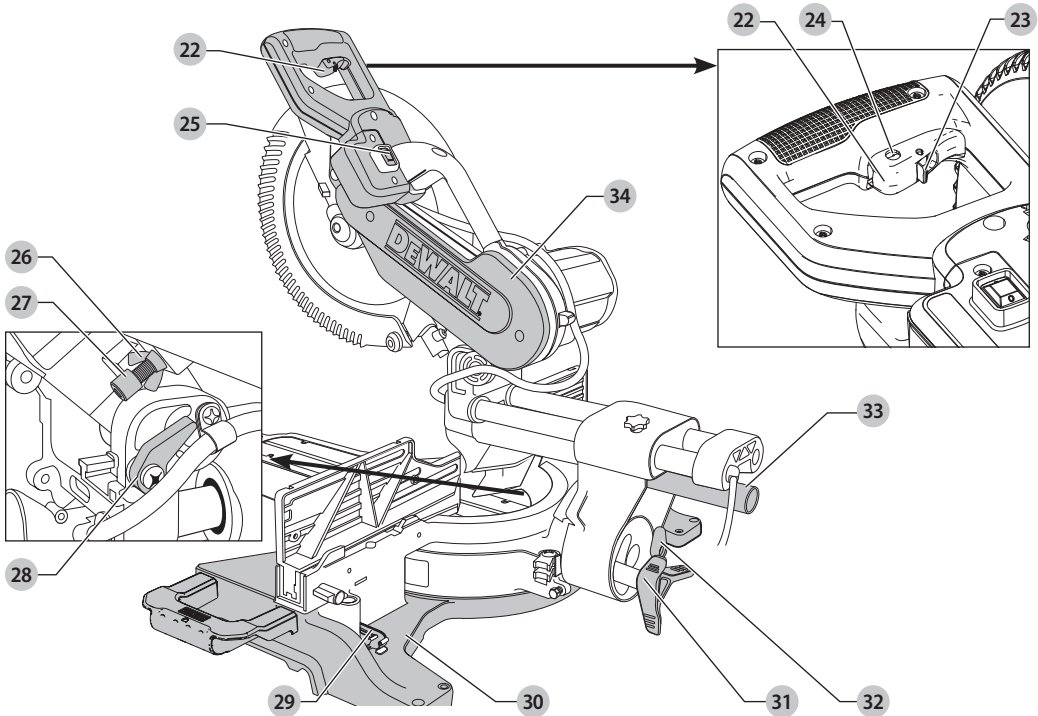


Fig. B
그림 B

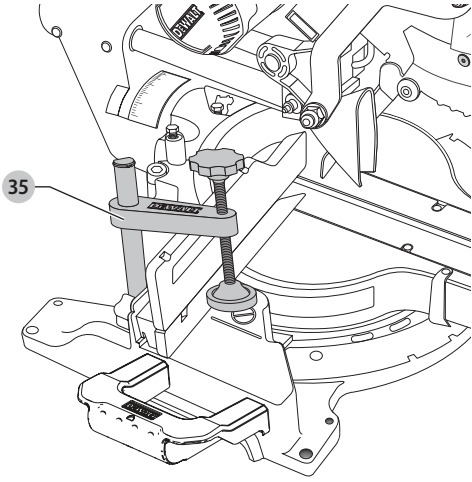


Fig. C
그림 C

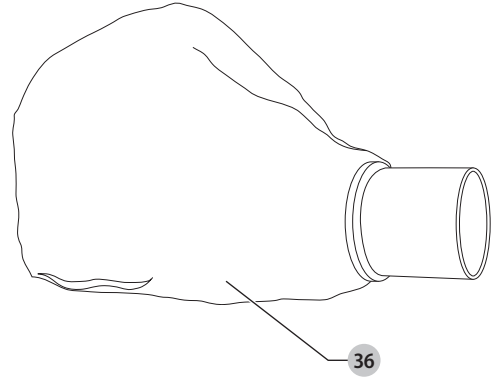


Fig. D
그림 D

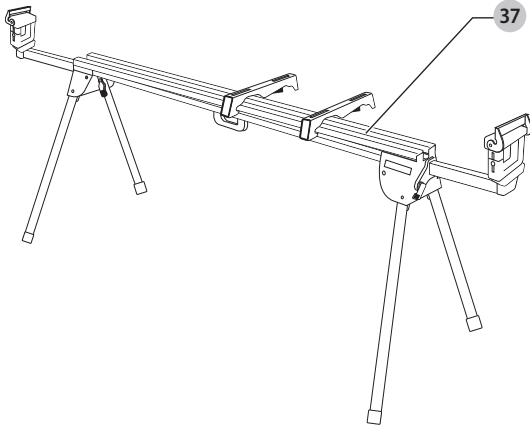


Fig. E
그림 E

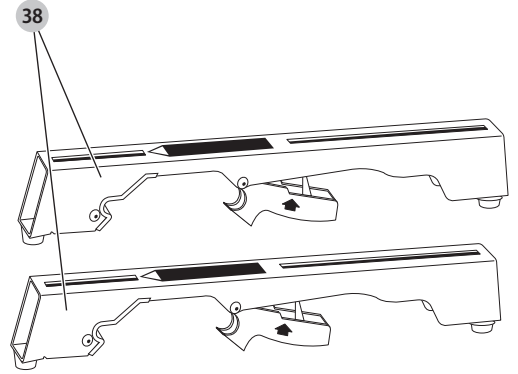


Fig. F
그림 F

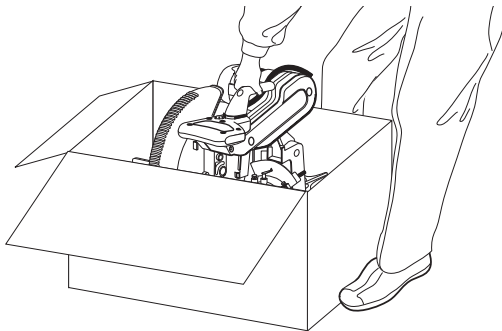


Fig. G1
그림 G1

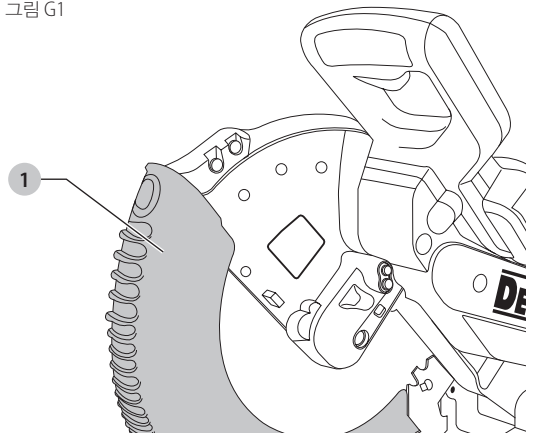


Fig. G2
그림 G2

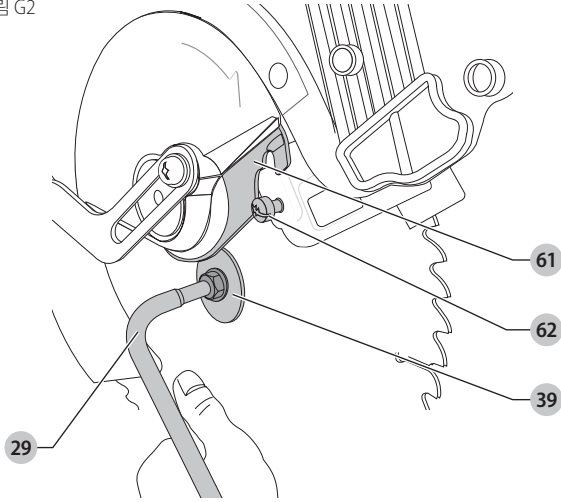


Fig. G3
그림 G3

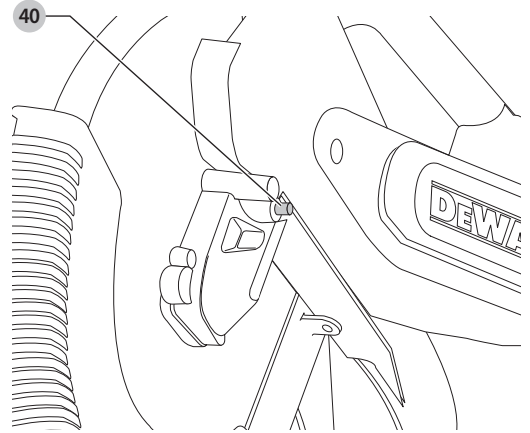


Fig. G4
그림 G4

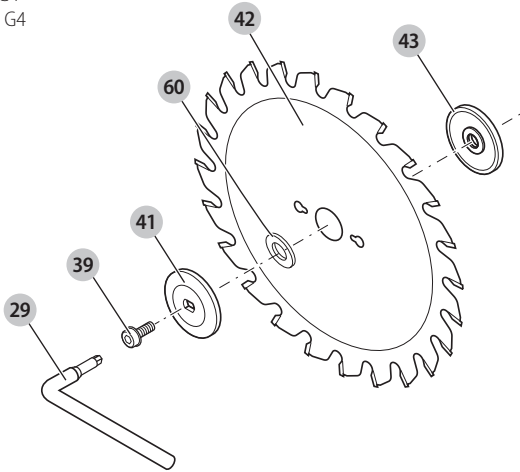


Fig. H
그림 H

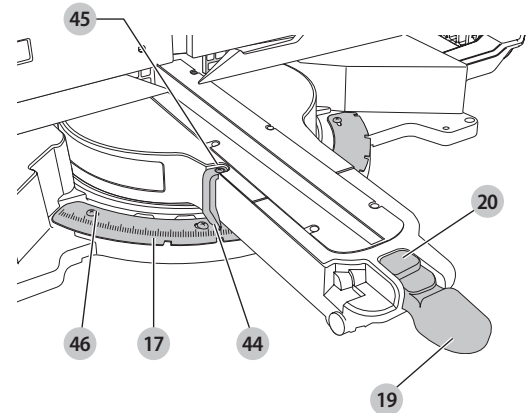


Fig. I
그림 I

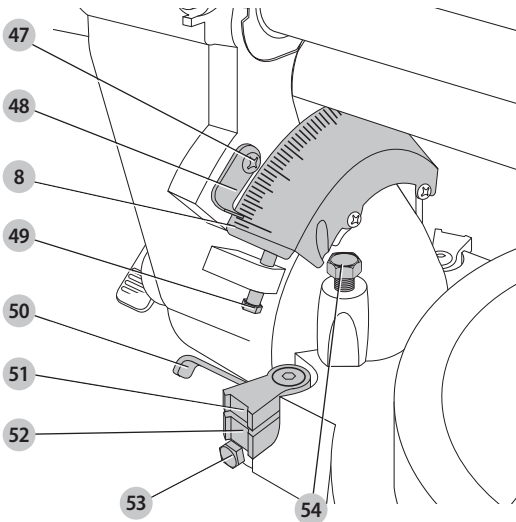


Fig. J
그림 J

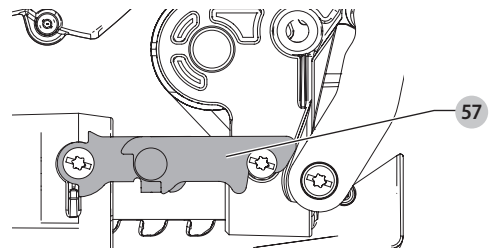


Fig. K
그림 K

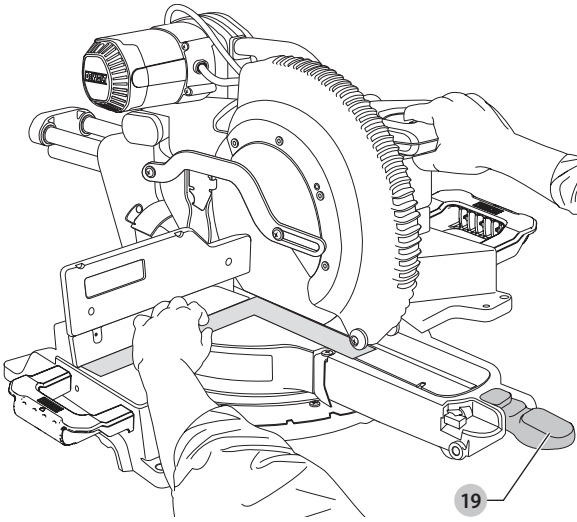


Fig. L
그림 L

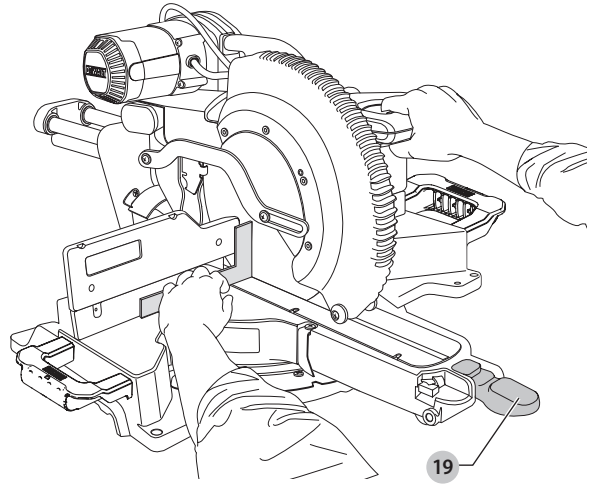


Fig. M
그림 M

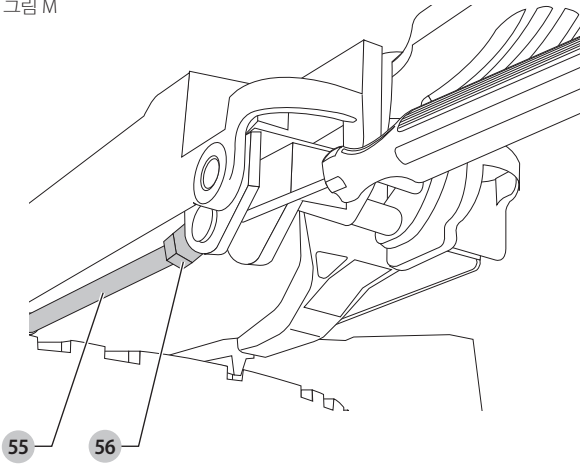


Fig. N1
그림 N1

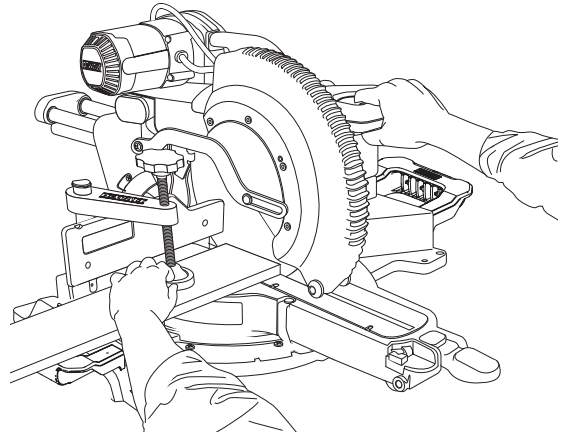


Fig. N2
그림 N2



Fig. O
그림 O

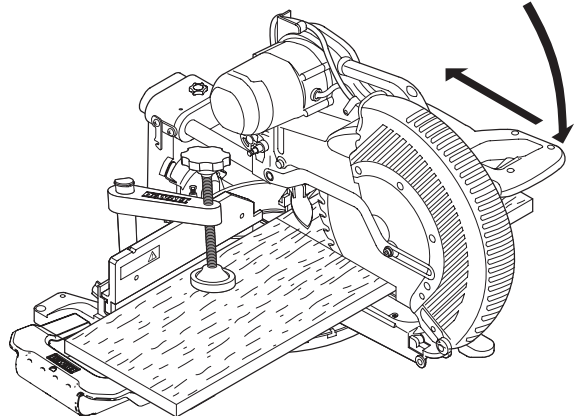


Fig. P
그림 P

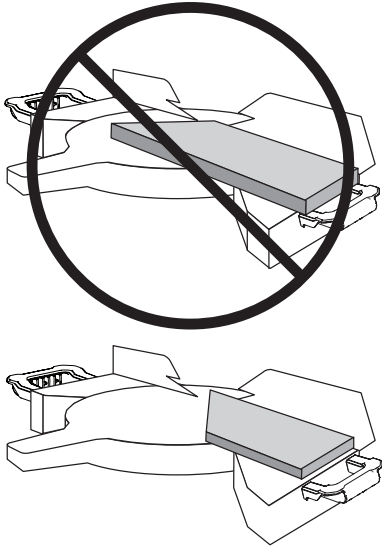


Fig. Q
그림 Q

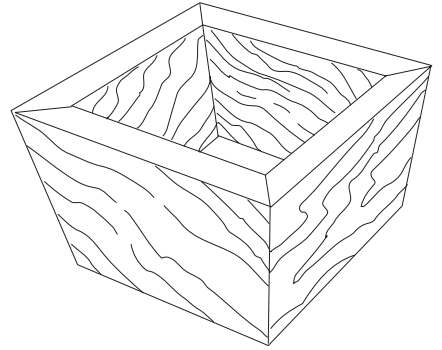


Fig. R
그림 R

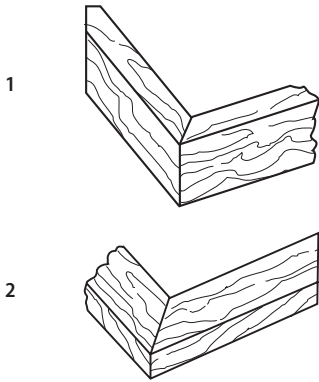


Fig. S
그림 S

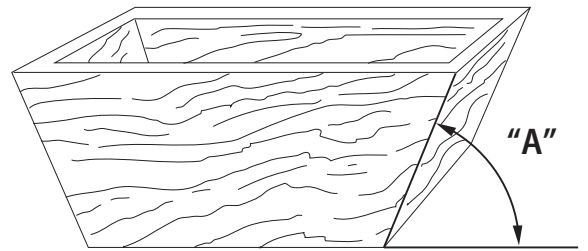


Fig. T
그림 T

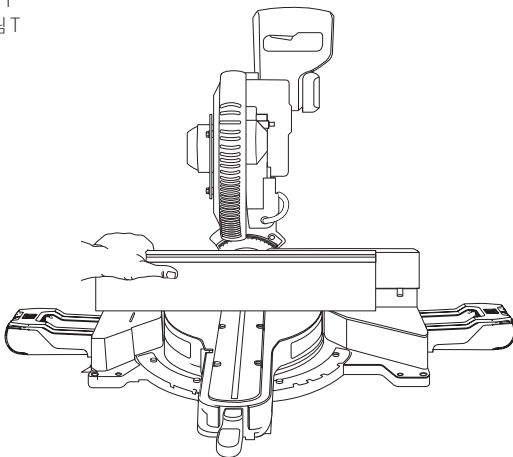


Fig. U1
그림 U1

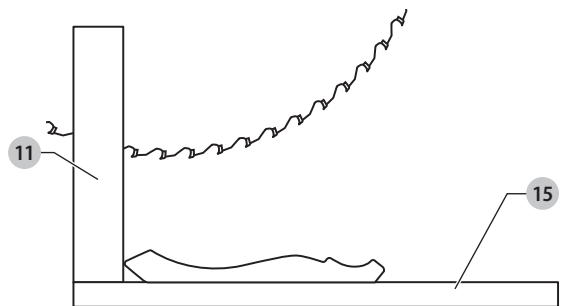


Fig. U2
그림 U2

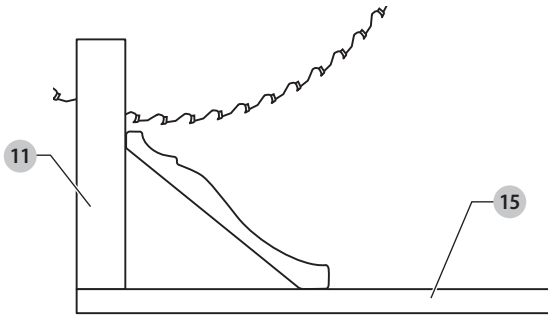


Fig. V1
그림 V1

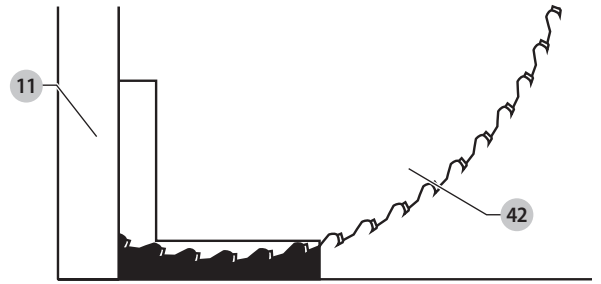


Fig. V2
그림 V2

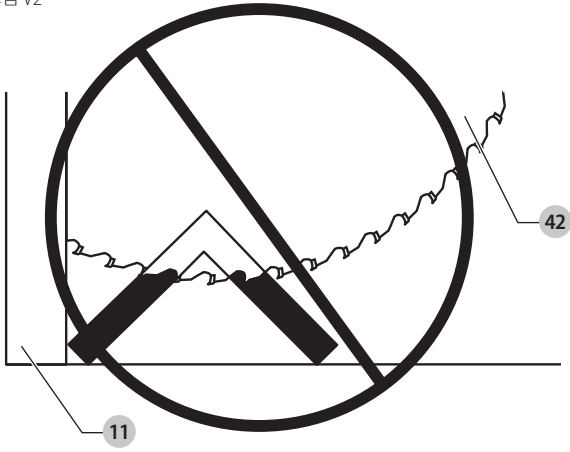


Fig. W1
그림 W1

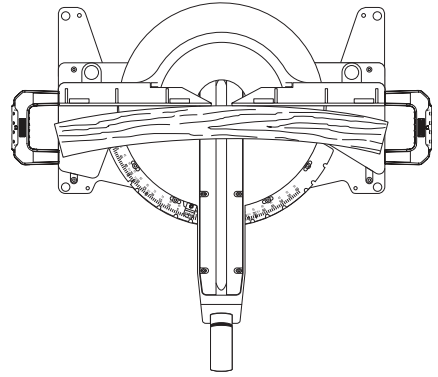


Fig. W2
그림 W2

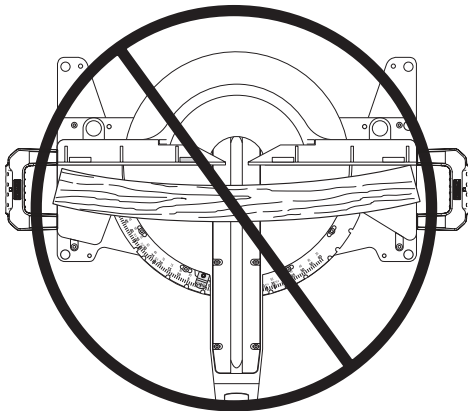


Fig. X
그림 X


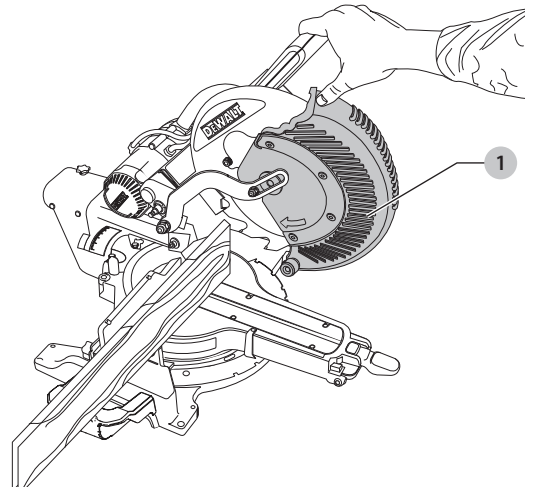


Fig. Y
그림 Y

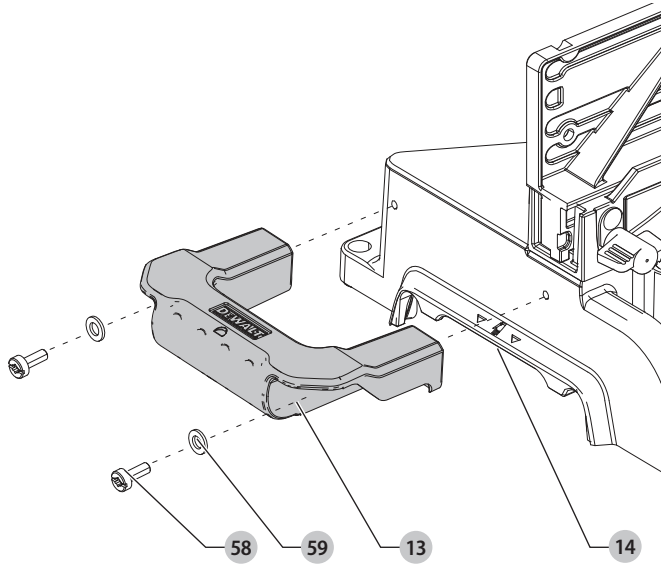

MITRE SAW

DWS780

Congratulations!

You have chosen a DEWALT tool. Years of experience, thorough product development and innovation make DEWALT one of the most reliable partners for professional power tool users.

Technical Data

		DWS780
Voltage	V _{AC}	220-240
Power input	W	1675
Blade diameter	mm	305
Blade bore	mm	25.4/30
Blade body thickness	mm	1.8
Max. kerf thickness	mm	2.4
Max. blade speed	min ⁻¹	3800
Max. cross-cut capacity 90°	mm	349
Max. mitre capacity 45°	mm	244
Max. depth of cut 90°	mm	112
Max. depth of bevel cross-cut 45°	mm	56
Mitre (max. positions)	left	50°
	right	60°
Bevel (max. positions)	left	49°
	right	49°
0° mitre		
Resulting width at max. height 112 mm	mm	299
Resulting width at max. height 110 mm	mm	303
Resulting height at max. width 345 mm	mm	76
45° mitre left		
Resulting width at max. height 112 mm	mm	200
Resulting height at max. width 244 mm	mm	76
45° mitre right		
Resulting width at max. height 112 mm	mm	211
Resulting height at max. width 244 mm	mm	76
45° bevel left		
Resulting width at max. height 63 mm	mm	268
Resulting height at max. width 345 mm	mm	44
45° bevel right		
Resulting width at max. height 62 mm	mm	193
Resulting height at max. width 345 mm	mm	28
Automatic blade brake time	s	< 10
Weight	kg	25.5



WARNING: To reduce the risk of injury, read the instruction manual.

Definitions: Safety Guidelines

The definitions below describe the level of severity for each signal word. Please read the manual and pay attention to these symbols.



DANGER: Indicates an imminently hazardous situation which, if not avoided, **will** result in **death or serious injury**.



WARNING: Indicates a potentially hazardous situation which, if not avoided, **could** result in **death or serious injury**.



CAUTION: Indicates a potentially hazardous situation which, if not avoided, **may** result in **minor or moderate injury**.

NOTICE: Indicates a practice **not related to personal injury** which, if not avoided, **may** result in **property damage**.



Denotes risk of electric shock.



Denotes risk of fire.

General Power Tool Safety Warnings



WARNING: Read all safety warnings, instructions, illustrations and specifications provided with this power tool. Failure to follow all instructions listed below may result in electric shock, fire and/or serious injury.

SAVE ALL WARNINGS AND INSTRUCTIONS FOR FUTURE REFERENCE.

The term "power tool" in the warnings refers to your mains-operated (corded) power tool or battery-operated (cordless) power tool.

Work Area Safety

- Keep work area clean and well lit.** Cluttered or dark areas invite accidents.
- Do not operate power tools in explosive atmospheres, such as in the presence of flammable liquids, gases or dust.** Power tools create sparks which may ignite the dust or fumes.
- Keep children and bystanders away while operating a power tool.** Distractions can cause you to lose control.

Electrical Safety

- Power tool plugs must match the outlet. Never modify the plug in any way. Do not use any adapter plugs with earthed (grounded) power tools.** Unmodified plugs and matching outlets will reduce risk of electric shock.
- Avoid body contact with earthed or grounded surfaces such as pipes, radiators, ranges and refrigerators.** There is an increased risk of electric shock if your body is earthed or grounded.
- Do not expose power tools to rain or wet conditions.** Water entering a power tool will increase the risk of electric shock.
- Do not abuse the cord. Never use the cord for carrying, pulling or unplugging the power tool. Keep cord away from heat, oil, sharp edges or moving parts.** Damaged or entangled cords increase the risk of electric shock.
- When operating a power tool outdoors, use an extension cord suitable for outdoor use.** Use of a cord suitable for outdoor use reduces the risk of electric shock.
- If operating a power tool in a damp location is unavoidable, use a residual current device (RCD) protected supply.** Use of an RCD reduces the risk of electric shock.

Personal Safety

- Stay alert, watch what you are doing and use common sense when operating a power tool. Do not use a power tool while you are tired or under the influence of drugs, alcohol or medication.** A moment of inattention while operating power tools may result in serious personal injury.
- Use personal protective equipment. Always wear eye protection.** Protective equipment such as a dust mask, non-skid safety shoes, hard hat or hearing protection used for appropriate conditions will reduce personal injuries.
- Prevent unintentional starting. Ensure the switch is in the off-position before connecting to power source and/or battery pack, picking up or carrying the tool.** Carrying power tools with your finger on the switch or energising power tools that have the switch on invites accidents.

- d) **Remove any adjusting key or wrench before turning the power tool on.** A wrench or a key left attached to a rotating part of the power tool may result in personal injury.
- e) **Do not overreach. Keep proper footing and balance at all times.** This enables better control of the power tool in unexpected situations.
- f) **Dress properly. Do not wear loose clothing or jewellery. Keep your hair and clothing away from moving parts.** Loose clothes, jewellery or long hair can be caught in moving parts.
- g) **If devices are provided for the connection of dust extraction and collection facilities, ensure these are connected and properly used.** Use of dust collection can reduce dust-related hazards.
- h) **Do not let familiarity gained from frequent use of tools allow you to become complacent and ignore tool safety principles.** A careless action can cause severe injury within a fraction of a second.

Power Tool Use and Care

- a) **Do not force the power tool. Use the correct power tool for your application.** The correct power tool will do the job better and safer at the rate for which it was designed.
- b) **Do not use the power tool if the switch does not turn it on and off.** Any power tool that cannot be controlled with the switch is dangerous and must be repaired.
- c) **Disconnect the plug from the power source and/or remove the battery pack, if detachable, from the power tool before making any adjustments, changing accessories, or storing power tools.** Such preventive safety measures reduce the risk of starting the power tool accidentally.
- d) **Store idle power tools out of the reach of children and do not allow persons unfamiliar with the power tool or these instructions to operate the power tool.** Power tools are dangerous in the hands of untrained users.
- e) **Maintain power tools and accessories. Check for misalignment or binding of moving parts, breakage of parts and any other condition that may affect the power tool's operation. If damaged, have the power tool repaired before use.** Many accidents are caused by poorly maintained power tools.
- f) **Keep cutting tools sharp and clean.** Properly maintained cutting tools with sharp cutting edges are less likely to bind and are easier to control.
- g) **Use the power tool, accessories and tool bits, etc. in accordance with these instructions, taking into account the working conditions and the work to be performed.** Use of the power tool for operations different from those intended could result in a hazardous situation.
- h) **Keep handles and grasping surfaces dry, clean and free from oil and grease.** Slippery handles and grasping surfaces do not allow for safe handling and control of the tool in unexpected situations.

Service

- a) **Have your power tool serviced by a qualified repair person using only identical replacement parts.** This will ensure that the safety of the power tool is maintained.

Safety Instructions for Mitre Saws

- a) **Mitre saws are intended to cut wood or wood-like products, they cannot be used with abrasive cut-off wheels for cutting ferrous material such as bars, rods, studs, etc.** Abrasive dust causes moving parts such as the lower guard to jam. Sparks from abrasive cutting will burn the lower guard, the kerf insert and other plastic parts.
- b) **Use clamps to support the workpiece whenever possible. If supporting the workpiece by hand, you must always keep your hand at least 100 mm from either side of the saw blade. Do not use this saw to cut pieces that are too small to be securely clamped or held by hand.** If your hand is placed too close to the saw blade, there is an increased risk of injury from blade contact.
- c) **The workpiece must be stationary and clamped or held against both the fence and the table. Do not feed the workpiece into the blade or cut "freehand" in any way.** Unrestrained or moving workpieces could be thrown at high speeds, causing injury.
- d) **Push the saw through the workpiece. Do not pull the saw through the workpiece. To make a cut, raise the saw head and pull it out over the workpiece without cutting, start the motor, press the saw head down and push the saw through the workpiece.** Cutting on the pull stroke is likely to cause the saw blade to climb on top of the workpiece and violently throw the blade assembly towards the operator.
- e) **Never cross your hand over the intended line of cutting either in front or behind the saw blade.** Supporting the workpiece "cross handed" i.e. holding the workpiece to the right of the saw blade with your left hand or vice versa is very dangerous.
- f) **Do not reach behind the fence with either hand closer than 100 mm from either side of the saw blade, to remove wood scraps, or for any other reason while the blade is spinning.** The proximity of the spinning saw blade to your hand may not be obvious and you may be seriously injured.
- g) **Inspect your workpiece before cutting. If the workpiece is bowed or warped, clamp it with the outside bowed face toward the fence. Always make certain that there is no gap between the workpiece, fence and table along the line of the cut.** Bent or warped workpieces can twist or shift and may cause binding on the spinning saw blade while cutting. There should be no nails or foreign objects in the workpiece.
- h) **Do not use the saw until the table is clear of all tools, wood scraps, etc., except for the workpiece.** Small debris or loose pieces of wood or other objects that contact the revolving blade can be thrown with high speed.
- i) **Cut only one workpiece at a time.** Stacked multiple workpieces cannot be adequately clamped or braced and may bind on the blade or shift during cutting.
- j) **Ensure the mitre saw is mounted or placed on a level, firm work surface before use.** A level and firm work surface reduces the risk of the mitre saw becoming unstable.
- k) **Plan your work. Every time you change the bevel or mitre angle setting, make sure the adjustable fence is set correctly to support the workpiece and will not interfere with the blade or the guarding system.** Without turning the tool "ON" and with no workpiece on the table, move the saw blade through a complete simulated cut to assure there will be no interference or danger of cutting the fence.
- l) **Provide adequate support such as table extensions, saw horses, etc. for a workpiece that is wider or longer than the table top.** Workpieces longer or wider than the mitre saw table can tip if not securely supported. If the cut-off piece or workpiece tips, it can lift the lower guard or be thrown by the spinning blade.
- m) **Do not use another person as a substitute for a table extension or as additional support.** Unstable support for the workpiece can cause the blade to bind or the workpiece to shift during the cutting operation pulling you and the helper into the spinning blade.
- n) **The cut-off piece must not be jammed or pressed by any means against the spinning saw blade.** If confined, i.e. using length stops, the cut-off piece could get wedged against the blade and thrown violently.
- o) **Always use a clamp or a fixture designed to properly support round material such as rods or tubing.** Rods have a tendency to roll while being cut, causing the blade to "bite" and pull the work with your hand into the blade.
- p) **Let the blade reach full speed before contacting the workpiece.** This will reduce the risk of the workpiece being thrown.

- q) **If the workpiece or blade becomes jammed, turn the mitre saw off. Wait for all moving parts to stop and disconnect the plug from the power source and/or remove the battery pack. Then work to free the jammed material.** Continued sawing with a jammed workpiece could cause loss of control or damage to the mitre saw.
- r) **After finishing the cut, release the switch, hold the saw head down and wait for the blade to stop before removing the cut-off piece.** Reaching with your hand near the coasting blade is dangerous.
- s) **Hold the handle firmly when making an incomplete cut or when releasing the switch before the saw head is completely in the down position.** The braking action of the saw may cause the saw head to be suddenly pulled downward, causing a risk of injury.

Additional Safety Rules for Mitre Saws



WARNING: Do not connect to the mains power supply into the unit until complete instructions are read and understood.

- **DO NOT OPERATE THIS MACHINE** until it is completely assembled and installed according to the instructions. A machine incorrectly assembled can cause serious injury.
- **OBTAIN ADVICE** from your supervisor, instructor, or another qualified person if you are not thoroughly familiar with the operation of this machine. Knowledge is safety.
- **MAKE CERTAIN** the blade rotates in the correct direction. The teeth on the blade should point in the direction of rotation as marked on the saw.
- **TIGHTEN ALL CLAMP HANDLES,** knobs and levers prior to operation. Loose clamps can cause parts or the workpiece to be thrown at high speeds.
- **BE SURE** all blade and blade clamps are clean, recessed sides of blade clamps are against blade and arbour screw is tightened securely. Loose or improper blade clamping may result in damage to the saw and possible personal injury.
- **DO NOT OPERATE ON ANYTHING OTHER THAN THE DESIGNATED VOLTAGE** for the saw. Overheating, damage to the tool and personal injury may occur.
- **DO NOT WEDGE ANYTHING AGAINST THE FAN** to hold the motor shaft. Damage to tool and possible personal injury may occur.
- **NEVER HAVE ANY PART OF YOUR BODY IN LINE WITH THE PATH OF THE SAW BLADE.** Personal injury will occur.
- **NEVER APPLY BLADE LUBRICANT TO A RUNNING BLADE.** Applying lubricant could cause your hand to move into the blade resulting in serious injury.
- **DO NOT** place either hand in the blade area when the saw is connected to the power source. Inadvertent blade activation may result in serious injury.
- **NEVER REACH AROUND OR BEHIND THE SAW BLADE.** A blade can cause serious injury.
- **DO NOT REACH UNDERNEATH THE SAW** unless it is unplugged and turned off. Contact with saw blade may cause personal injury.
- **SECURE THE MACHINE TO A STABLE SUPPORTING SURFACE.** Vibration can possibly cause the machine to slide, walk, or tip over, causing serious injury.
- **USE ONLY CROSSCUT SAW BLADES** recommended for mitre saws. For best results, do not use carbide tipped blades with hook angles in excess of 7 degrees. Do not use blades with deep gullets. These can deflect and contact the guard, and can cause damage to the machine and/or serious injury.
- **USE ONLY BLADES OF THE CORRECT SIZE AND TYPE** specified for this tool to prevent damage to the machine and/or serious injury (complying with EN847-1).
- **INSPECT BLADE FOR CRACKS** or other damage prior to operation. A cracked or damaged blade can come apart and pieces can be thrown at high speeds, causing serious injury. Replace cracked or damaged blades immediately. Observe the maximum speed marked on the saw blade.

- **CLEAN THE BLADE AND BLADE CLAMPS** prior to operation. Cleaning the blade and blade clamps allows you to check for any damage to the blade or blade clamps. A cracked or damaged blade or blade clamp can come apart and pieces can be thrown at high speeds, causing serious injury.
- **THE MAXIMUM SPEED OF THE SAW BLADE** shall always be greater than or at least equal to the speed marked on the rating plate of the tool.
- **THE SAW BLADE DIAMETER** must be in accordance with the markings on rating plate of the tool.
- **DO NOT USE WARPED BLADES.** Check to see if the blade runs true and is free from vibration. A vibrating blade can cause damage to the machine and/or serious injury.
- **DO NOT** use lubricants or cleaners (particularly spray or aerosol) in the vicinity of the plastic guard. The polycarbonate material used in the guard is subject to attack by certain chemicals.
- **KEEP GUARD IN PLACE** and in working order.
- **ALWAYS USE THE KERF PLATE AND REPLACE THIS PLATE WHEN DAMAGED.** Small chip accumulation under the saw may interfere with the saw blade or may cause instability of workpiece when cutting.
- **USE ONLY BLADE CLAMPS SPECIFIED FOR THIS TOOL** to prevent damage to the machine and/or serious injury.
- **MAKE SURE** to use the correct saw blade for the material to be cut.
- **CLEAN THE MOTOR AIR SLOTS** of chips and sawdust. Clogged motor air slots can cause the machine to overheat, damaging the machine and possibly causing a short which could cause serious injury.
- **NEVER LOCK THE SWITCH IN THE "ON" POSITION.** Severe personal injury may result.
- **NEVER STAND ON TOOL.** Serious injury could occur if the tool is tipped or if the cutting tool is unintentionally contacted.



WARNING: Cutting plastics, sap coated wood, and other materials may cause melted material to accumulate on the blade tips and the body of the saw blade, increasing the risk of blade overheating and binding while cutting.



WARNING: Always wear proper personal hearing protection. Under some conditions and duration of use, noise from this product may contribute to hearing loss. Be aware of the following factors influencing exposure to noise:

- Use saw blades designed to reduce the emitted noise,
- Use only well sharpened saw blades, and
- Use specially designed noise-reduction saw blades.



WARNING: ALWAYS use safety glasses. Everyday eyeglasses are NOT safety glasses. Also use face or dust mask if cutting operation is dusty.



WARNING: Use of this tool can generate and/or disperse dust, which may cause serious and permanent respiratory or other injury.



WARNING: Some dust created by power sanding, sawing, grinding, drilling, and other construction activities contains chemicals known to cause cancer, birth defects or other reproductive harm. Some examples of these chemicals are:

- lead from lead-based paints,
- crystalline silica from bricks and cement and other masonry products, and
- arsenic and chromium from chemically-treated lumber.

Your risk from these exposures varies, depending on how often you do this type of work. To reduce your exposure to these chemicals: work in a well ventilated area, and work with approved safety equipment, such as those dust masks that are specially designed to filter out microscopic particles.

- **Avoid prolonged contact with dust from power sanding, sawing, grinding, drilling, and other construction activities.** Wear protective clothing and wash exposed areas with soap and water. Allowing dust to get into your mouth, eyes, or lay on the skin may promote absorption of harmful chemicals.



WARNING: Use of this tool can generate and/or disperse dust, which may cause serious and permanent respiratory or other injury. Always use approved respiratory protection appropriate for the dust exposure.

Residual Risks

The following risks are inherent to the use of saws:

- Injuries caused by touching the rotating parts.

In spite of the application of the relevant safety regulations and the implementation of safety devices, certain residual risks cannot be avoided. These are:

- Impairment of hearing.
- Risk of accidents caused by the uncovered parts of the rotating saw blade.
- Risk of injury when changing the blade.
- Risk of squeezing fingers when opening the guards.
- Health hazards caused by breathing dust developed when sawing wood, especially oak, beech and MDF.

The following factors increase the risk of breathing problems:

- No dust extractor connected when sawing wood.
- Insufficient dust extraction caused by uncleaned exhaust filters.

Electrical Safety

The electric motor has been designed for one voltage only. Always check that the power supply corresponds to the voltage on the rating plate.



Your DEWALT tool is double insulated in accordance with IEC62841; therefore no earth wire is required.

If the supply cord is damaged, it must be replaced only by DEWALT or an authorised service organisation.

Using an Extension Cable

If an extension cable is required, use an approved 3-core extension cable suitable for the power input of this tool (see **Technical Data**). The minimum conductor size is 1.5 mm²; the maximum length is 30 m.

When using a cable reel, always unwind the cable completely.

Package Contents

The package contains:

- 1 Assembled mitre saw
 - 2 Base extensions and installation hardware
 - 1 Blade wrench (see placement in Fig. A2)
 - 1 Saw blade
 - 1 Dustbag
 - 1 Material clamp
 - 1 Instruction manual
- Check for damage to the tool, parts or accessories which may have occurred during transport.
 - Take the time to thoroughly read and understand this manual prior to operation.

Markings on Tool

The following pictograms are shown on the tool:



Read instruction manual before use.



Wear ear protection.



Wear eye protection.



Keep hands away from blade.



Keep hands 100 mm from either side of saw blade.



Do not stare directly into the light source.



Carrying point.

Date Code Position (Fig. A1)

The date code **6**, which also includes the year of manufacture, is printed into the housing.

Example:

2019 XX XX
Year of Manufacture

Description (Fig. A1–E)



WARNING: Never modify the power tool or any part of it. Damage or personal injury could result.

Fig. A1

- 1 Lower guard
- 2 Operating handle
- 3 Carrying handle
- 4 Rail lock knob
- 5 Rail set screw adjustment
- 6 Date code
- 7 Rails
- 8 Bevel scale
- 9 Lock down pin
- 10 Fence adjustment knob
- 11 Fence
- 12 Base fence
- 13 Base extension handles
- 14 Hand indentation
- 15 Table
- 16 Bench mounting holes
- 17 Mitre scale
- 18 Dust duct inlet
- 19 Mitre lock handle
- 20 Mitre latch button
- 21 Kerf plate

Fig. A2

- 22 Trigger switch
- 23 Lock-off lever
- 24 Padlock hole
- 25 XPS on/off switch
- 26 Wing nut
- 27 Depth adjustment screw
- 28 Grooving stop
- 29 Blade wrench
- 30 Base
- 31 Bevel lock knob
- 32 0° bevel stop override
- 33 Dust extraction port
- 34 Belt cover
- 35 Workpiece clamp (Fig. B)

Optional accessories

Fig. C

- 36 DW7053-XJ Dustbag

Fig. D

- 37 DE7023-XJ / DE7033-XJ Leg stand

Fig. E

- 38 DE7025-XJ Clamp brackets

Intended Use

Your DEWALT DWS780 mitre saw has been designed for professional cutting of wood, wood products and plastics. When using the appropriate saw blades, sawing aluminium is also possible. It performs the sawing operations of cross-cutting, bevelling and mitring easily, accurately and safely.

This unit is designed for use with a nominal blade diameter 305 mm carbide tip blade.

DO NOT use under wet conditions or in the presence of flammable liquids or gases.

These mitre saws are professional power tools.

DO NOT let children come into contact with the tool. Supervision is required when inexperienced operators use this tool.

WARNING: Do not use the machine for purposes other than intended.

- This product is not intended for use by persons (including children) suffering from diminished physical, sensory or mental abilities; lack of experience, knowledge or skills unless they are supervised by a person responsible for their safety. Children should never be left alone with this product.

ASSEMBLY AND ADJUSTMENTS

WARNING: To reduce the risk of injury, turn unit off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure the trigger switch is in the OFF position. An accidental start-up can cause injury.

Unpacking (Fig. A1, F)

- Open the box and lift the saw out by the convenient carrying handle **3**, as shown in Figure F.
- Place the saw on a smooth, flat surface.
- Release the rail lock knob **4**, and push the saw head back to lock it in the rear position.
- Press down lightly on the operating handle **2** and pull out the lock down pin **9**.
- Gently release the downward pressure and hold the operating handle, allowing it to rise to its full height.

Bench Mounting (Fig. A1)

Holes **16** are provided in all four feet to facilitate bench mounting. Two different-sized holes are provided to accommodate different sizes of screws. Use either hole; it is not necessary to use both.

Always mount your saw firmly to a stable surface to prevent movement.

To enhance the tool's portability, it can be mounted to a piece of 12.7 mm or thicker plywood which can then be clamped to your work support or moved to other job sites and reclamped.

NOTE: If you elect to mount your saw to a piece of plywood, make sure that the mounting screws don't protrude from the bottom of the wood. The plywood must sit flush on the work support. When clamping the saw to any work surface, clamp only on the clamping bosses where the mounting screw holes are located. Clamping at any other point will interfere with the proper operation of the saw.

CAUTION: To prevent binding and inaccuracy, be sure the mounting surface is not warped or otherwise uneven. If the saw rocks on the surface, place a thin piece of material under one saw foot until the saw sits firmly on the mounting surface.

Kerf Plate Replacement (Fig. A1)

To remove the kerf plate **21**, remove the screws holding the kerf plate in place and replace with a new one.

Assemble the screws back in by following this sequence: first through the round holes located halfway from the ends, then through the slots at the ends. No adjustment is necessary.

Assembling the Base Extensions (Fig. Y)

WARNING: Base extensions must be assembled to both sides of the saw's base before using the saw.

WARNING: Be sure to adjust the base extensions using the mounting slots so they are level with the saw's base.

- Locate the holes above the hand indentations **14** on the side of the base.
- Using a hex wrench, attach the screw **58** through the washer **59**, through the base extension **13**, and into the holes on the base.
- Ensure the extension is secure by pulling on the extension to verify no movement.
- Repeat steps 1 through 3 on the other side.

NOTE: Make sure the extensions are level with the work surface so that the workpiece rests evenly. A straight workpiece should have no gap between it and the base extensions.

Changing or Installing a New Saw Blade

WARNING: To reduce the risk of injury, wear gloves when handling the saw blade.

WARNING: To reduce the risk of injury, turn unit off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure the trigger switch is in the OFF position. An accidental start-up can cause injury.

- Never depress the spindle lock button while the blade is under power or coasting.
- Do not cut light alloy and ferrous metal (containing iron or steel) or masonry or fibre cement product with this mitre saw.

Removing the Blade (Fig. G1–G4)

- Unplug the saw.
- Raise the arm to the upper position and raise the lower guard **1** as far as possible.
- Loosen, but do not remove guard bracket screw **62** until the bracket **61** can be raised far enough to access the blade screw **39**. Lower guard will remain raised due to the position of the guard bracket screw.
- Depress the spindle lock button **40** while carefully rotating the saw blade **42** by hand until the lock engages.
- Keeping the button depressed, use the other hand and the wrench provided **29** to loosen the blade screw. (Turn clockwise, left-hand threads.)
- Remove the blade screw **39**, outer clamp washer **41**, blade **42** and blade adapter **60**, if used. The inner clamp washer **43** may be left on the spindle.

NOTE: For blades with a blade hole of 15.88 mm (5/8"), the 25.4 mm (1") blade adapter **60** is not used.

Installing a Blade (Fig. G1–G4)

- Unplug the saw.
- With the arm raised, the lower guard held open and the guard bracket raised **61**, place the blade on the spindle, onto the blade adapter (if using a blade with a 1" [25.4 mm] diameter blade hole) and against the inner blade clamp with the teeth at the bottom of the blade pointing toward the back of the saw.
- Assemble the outer clamp washer **41** onto the spindle.
- Install the blade screw **39** and, engaging the spindle lock, tighten the screw firmly with wrench provided (turn counterclockwise, left-hand threads).


NOTE: When using blades with a 5/8" (15.88 mm) diameter blade hole, the blade adapter will not be used and should be stored in a safe place for future use. The separate blade adapter is not available on all models.

5. Return the guard bracket to its original position and firmly tighten the guard bracket screw to hold bracket in place.

WARNING:

- The guard bracket must be returned to its original position and the guard bracket screw tightened before activating the saw. Failure to do so may allow the guard to contact the spinning saw blade resulting in damage to the saw and severe personal injury.


Transporting the Saw (Fig. A1, A2)

 **WARNING: To reduce the risk of serious personal injury, ALWAYS lock the rail lock knob, mitre lock handle, bevel lock handle, lock down pin and fence adjustment knobs before transporting saw. Never use guards for transporting or lift up.**

In order to conveniently carry the mitre saw, a carrying handle **3** has been included on the top of the saw arm.

- To transport the saw, lower the head and depress the lock down pin **9**.
- Lock the rail lock knob with the saw head in the front position, lock the mitre arm in the full left mitre angle, slide the fence **11** completely inward and lock the bevel lock knob **31** with the saw head in the vertical position to make the tool as compact as possible.
- Always use the carrying handle **3** or the hand indentations **14**.

Features and Controls

 **WARNING: To reduce the risk of injury, turn unit off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure the trigger switch is in the OFF position. An accidental start-up can cause injury.**

Mitre Control (Fig. H)

The mitre lock handle **19** and mitre latch button **20** allow you to mitre your saw to 60° right and 50° left. To mitre the saw, lift the mitre lock handle, push the mitre latch button and set the mitre angle desired on the mitre scale **17**. Push down on the mitre lock handle to lock the mitre angle.

Bevel Lock Knob (Fig. A2)

The bevel lock allows you to bevel the saw 49° left or right. To adjust the bevel setting, turn the bevel lock knob **31** counterclockwise. The saw head bevels easily to the left or to the right once the 0° bevel override knob is pulled. To tighten, turn the bevel lock knob clockwise.

0° Bevel Override (Fig. A2)

The 0° bevel stop override **32** allows you to bevel the saw to the right past the 0° mark.

When engaged, the saw will automatically stop at 0° when brought up from the left. To temporarily move past 0° to the right, pull the bevel stop override **32**. Once it is released, the override will be reengaged. The bevel stop override can be locked out by twisting the knob 180°.

When at 0°, the override locks in place. To operate the override, bevel the saw slightly to the left.

45° Bevel Stop Override (Fig. I)

There are two bevel stop override levers, one on each side of the saw.

To bevel the saw, left or right, past 45°, push the 45° bevel override lever **50** rearward. When in the rearward position, the saw can bevel past these stops. When the 45° stops are needed, pull the 45° bevel override lever forward.

Crown Bevel Pawls (Fig. I)

When cutting crown molding laying flat, your saw is equipped to accurately and rapidly set a crown stop, left or right (refer to *Instructions for Cutting Crown Molding Laying Flat and Using the Compound Features*)

The crown bevel pawl **52** can be rotated to contact the crown adjustment screw.

To reverse the crown bevel pawl, remove the retaining screw, the 22.5° bevel pawl **51** and the 30° crown bevel pawl **52**. Flip the crown bevel

pawl **52** so the 33.86° text is facing up. Reattach the screw to secure the 22.5° bevel pawl and the crown bevel pawl. The accuracy setting will not be affected.

22.5° Bevel Pawls (Fig. I)

Your saw is equipped to rapidly and accurately set a 22.5° bevel, left or right. The 22.5° bevel pawl **51** can be rotated to contact the crown adjustment screw **49**.


Rail Lock Knob (Fig. A1)

The rail lock knob **4** allows you to lock the saw head firmly to keep it from sliding on the rails **7**. This is necessary when making certain cuts or when transporting the saw.

Grooving Stop (Fig. A2)

The grooving stop **28** allows the depth of cut of the blade to be limited. The stop is useful for applications such as grooving and tall vertical cuts. Rotate the grooving stop forward and adjust the depth adjustment screw **27** to set the desired depth of cut. To secure the adjustment, tighten the wing nut **26**. Rotating the grooving stop to the rear of the saw will bypass the grooving stop feature. If the depth adjustment screw is too tight to loosen by hand, the provided blade wrench **29** can be used to loosen the screw.

Lock Down Pin (Fig. A1)

 **WARNING: The lock down pin should be used only when carrying or storing the saw. NEVER use the lock down pin for any cutting operation.**

To lock the saw head in the down position, push the saw head down, push the lock down pin **9** in and release the saw head. This will hold the saw head safely down for moving the saw from place to place. To release, press the saw head down and pull the pin out.

Slide Lock Lever (Fig. J, T)

The slide lock lever **57** places the saw in a position to maximize cutting of base moulding when cut vertically as shown in Figure T.

Adjustment

Your mitre saw is fully and accurately adjusted at the factory at the time of manufacture. If readjustment due to shipping and handling or any other reason is required, follow the instructions below to adjust your saw. Once made, these adjustments should remain accurate.

Mitre Scale Adjustment (Fig. H, K)

1. Unlock the mitre lock handle **19** and swing the mitre arm until the mitre latch button **20** locks it at the 0° mitre position. Do not lock the mitre lock handle.
2. Place a square against the saw's fence and blade, as shown. (Do not touch the tips of the blade teeth with the square. To do so will cause an inaccurate measurement.)
3. If the saw blade is not exactly perpendicular to the fence, loosen the four screws **46** that hold the mitre scale **17** and move the mitre lock handle and the scale left or right until the blade is perpendicular to the fence, as measured with the square.
4. Retighten the four screws. Pay no attention to the reading of the mitre pointer **44** at this time.

Mitre Pointer Adjustment (Fig. H)

1. Unlock the mitre lock handle **19** to move the mitre arm to the zero position.
2. With the mitre lock handle unlocked, allow the mitre latch to snap into place as you rotate the mitre arm to zero.
3. Observe the mitre pointer **44** and mitre scale **17** shown in Figure H. If the pointer does not indicate exactly zero, loosen the mitre pointer screw **45** holding the pointer in place, reposition the pointer and tighten the screw.

Bevel Square to Table Adjustment

(Fig. A1, A2, I, L)

- To align the blade square to the table, lock the arm in the down position with the lock down pin **9**.
- Place a square against the blade, ensuring the square is not on top of a tooth (Fig. L).
- Loosen the bevel lock knob **31** and ensure the arm is firmly against the 0° bevel stop.
- Rotate the 0° bevel adjustment screw (54 Fig. I) with the 6 mm hex blade wrench **29** as necessary so that the blade is at 0° bevel to the table.

Bevel Pointer Adjustment (Fig. I)

If the bevel pointers **48** do not indicate zero, loosen each screw **47** that holds each bevel pointer in place and move them as necessary. Ensure the 0° bevel is correct and the bevel pointers are set before adjusting any other bevel angle screws.

Bevel Stop 45° Right and Left Adjustment (Fig. A2, I)

To adjust the right 45° bevel stop:

- Loosen the bevel lock knob **31** and pull the 0° bevel stop override **32** to override the 0° bevel stop.
- When the saw is fully to the right, if the bevel pointer **48** does not indicate exactly 45°, turn the left 45° bevel adjustment screw **53** with the 6 mm hex blade wrench **29** until the bevel pointer indicates 45°.

To adjust the left 45° bevel stop:

- Loosen the bevel lock knob and tilt the head to the left.
- If the bevel pointer does not indicate exactly 45°, turn the right 45° bevel adjustment screw until the bevel pointer reads 45°.

Adjusting the Bevel Stop to 22.5° (or 30°) (Fig. A2, I)

NOTE: Adjust the bevel angles only after performing the 0° bevel angle and bevel pointer adjustment.

To set the left 22.5° bevel angle, flip out the left 22.5° bevel pawl **51**. Loosen the bevel lock knob **31** and tilt the head fully to the left. If the bevel pointer **48** does not indicate exactly 22.5°, turn the crown adjustment screw **49** contacting the pawl with a 10 mm wrench until the bevel pointer reads 22.5°.

To adjust the right 22.5° bevel angle, flip out the right 22.5° bevel pawl. Loosen the bevel lock knob and pull the 0° bevel stop **32** to override the 0° bevel stop. When the saw is fully to the right, if the bevel pointer does not indicate exactly 22.5°, turn the crown adjustment screw **49** contacting the pawl with a 10 mm wrench until the bevel pointer indicates exactly 22.5°.

Fence Adjustment (Fig. A1)

The upper part of the fence can be adjusted to provide clearance, allowing the saw to bevel to a full 49° both left and right.

- To adjust each fence **11**, loosen the fence adjustment knob **10** and slide the fence outward.
- Make a dry run with the saw turned off and check for clearance.
- Adjust the fence to be as close to the blade as practical to provide maximum workpiece support, without interfering with arm up and down movement.
- Tighten the fence adjustment knob securely.
- When the bevel operations are complete, relocate the fence.

For certain cuts, it may be desirable to bring the fences closer to the blade. To do so, loosen the fence adjustment knobs **10** and slide the fences closer to the blade past the normal limit, then tighten the fence adjustment knobs. Make a dry cut first to ensure the blade does not contact the fences.

For certain cuts it may be desirable to remove the sliding fence. To do so, loosen the fence adjustment knobs **10** and slide the fence completely free of the base fence. Once the cut is complete, replace the sliding fence.

NOTE: The tracks of the fences can become clogged with sawdust. Use a brush or some low pressure air to clear the guide grooves.

Guard Actuation and Visibility (Fig. X)

The lower guard **1** on your saw has been designed to automatically uncover the blade when the arm is brought down and to cover the blade when the arm is raised.

The guard can be raised by hand when installing or removing saw blades or for inspection of the saw. NEVER RAISE THE lower GUARD MANUALLY UNLESS THE BLADE IS STOPPED.

Rail Guide Adjustment (Fig. A1)

Regularly check the rails **7** for play or clearance.

The right rail can be adjusted with the set screw **5**. To reduce clearance, use a 4 mm hex wrench and rotate the set screw clockwise gradually while sliding the saw head back and forth.

Mitre Lock Adjustment (Fig. A1, M)

The mitre lock rod **55** should be adjusted if the table of the saw can be moved when the mitre lock handle is locked (down).

- Put the mitre lock handle **19** in the unlocked (up) position.
- Using a 13 mm open end wrench, loosen the lock nut **56** on the mitre lock rod.
- Using a slotted screwdriver, tighten the mitre lock rod by turning it clockwise as shown in Figure M. Turn the lock rod until it is snug, then turn counterclockwise one turn.
- Re-lock the mitre lock to a non-detented measurement on the mitre scale – for example, 34° – and make sure the table will not rotate.
- Tighten lock nut.

Prior to Operation

- Install the base extensions to both sides of the saw's base. Refer to **Assembling the Base Extensions** section.
- Check the protective belt cover for damage and the proper functioning of the lower guard.
- Make sure to use the kerf plate. Do not operate the machine if the kerf slot is wider than 12 mm.
- Install the appropriate saw blade. Do not use excessively worn blades. The maximum rotation speed of the tool must not exceed that of the saw blade.
- Make sure all locking knobs and clamp handles are tight.
- Use personal protective equipment and connect the saw to an external dust extractor.
- Although this saw will cut wood and many nonferrous materials, these operating instructions refer to the cutting of wood only. The same guidelines apply to the other materials. Do not cut ferrous (iron and steel) materials, fibre cement or masonry with this saw!
- Do not attempt to cut excessively small pieces.
- Secure the workpiece.
- Allow the blade to cut freely. Do not force.
- Allow the motor to reach full speed before cutting.

OPERATION

Instructions for Use



WARNING: Always observe the safety instructions and applicable regulations.



WARNING: To reduce the risk of injury, turn unit off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure the trigger switch is in the OFF position. An accidental start-up can cause injury.

Refer to **Saw Blades** under **Optional Accessories** to select the blade that best fits your needs.

Ensure the machine is placed to satisfy your ergonomic conditions in terms of table height and stability. The machine site shall be chosen so that the

operator has a good overview and enough free surrounding space around the machine that allows handling of the workpiece without any restrictions. To reduce effects of vibration, make sure the environment temperature is not too cold, the machine and accessories are well maintained and the workpiece size is suitable for this machine.

Be sure the cord will not interfere with your work.

Proper Body and Hand Position (Fig. N1, N2)



WARNING: To reduce the risk of serious personal injury, **ALWAYS** use proper hand position as shown in Figure N1.



WARNING: To reduce the risk of serious personal injury, **ALWAYS** hold securely in anticipation of a sudden reaction.

- Never place hands near cutting area. Place hands no closer than 100 mm from the blade.
- Hold the workpiece tightly to the table and the fence when cutting. Keep hands in position until the trigger has been released and the blade has completely stopped.
- ALWAYS MAKE DRY RUNS (UNPOWERED) BEFORE FINISH CUTS SO THAT YOU CAN CHECK THE PATH OF THE BLADE. DO NOT CROSS HANDS, AS SHOWN IN FIGURE N2.
- Keep both feet firmly on the floor and maintain proper balance. As you move the mitre arm left and right, follow it and stand slightly to the side of the saw blade.
- Sight through the guard louvers when following a pencil line.

Trigger Switch (Fig. A2)

To turn the saw on, push the lock-off lever **23** to the left, then depress the trigger switch **22**. The saw will run while the switch is depressed. Allow the blade to spin up to full operating speed before making the cut. To turn the saw off, release the switch. Allow the blade to stop before raising the saw head. There is no provision for locking the switch on. A hole **24** is provided in the trigger for insertion of a padlock to lock the switch off.

Your saw is not equipped with an automatic electric blade brake, but the saw blade should stop within 10 seconds of trigger release. This is not adjustable. If the stop time repeatedly exceeds 10 seconds, have the tool serviced by an authorised DeWALT service centre.

Always be sure the blade has stopped before removing it from the kerf.

Dust Extraction (Fig. A2, C)



WARNING: Certain dust, such as oak or beech dust, is considered carcinogenic, especially in connection with wood-treatment additives.

- Always use dust extraction.
- Provide for good ventilation of the work space.
- It is recommended to wear an appropriate respirator.

Your saw has a built-in dust port **33** that allows either a dust bag **36** or a shop vacuum system to be connected.

To Attach the Dust Bag

1. Fit the dust bag **36** to the dust port **33**.

To Empty the Dust Bag

1. Remove dust bag **36** from the saw and gently shake or tap the dust bag to empty.
2. Reattach the dust bag back onto the dust port **33**.

You may notice that all the dust will not come free from the bag. This will not affect cutting performance but will reduce the saw's dust collection efficiency. To restore your saw's dust collection efficiency, depress the spring inside the dust bag when you are emptying it and tap it on the side of the trash can or dust receptacle.



CAUTION: Never operate this saw unless the dust bag or DeWALT dust extractor is in place. Wood dust may create a breathing hazard.

Use of XPS LED Worklight System (Fig. A1, A2)

NOTE: The mitre saw must be connected to a power source.

The XPS LED Worklight System is equipped with an on/off switch **25**. The XPS LED Worklight System is independent of the mitre saw's trigger switch. The light does not need to be on in order to operate the saw.

To cut through an existing pencil line on a piece of wood:

1. Turn on the XPS system, then pull down on the operating handle **2** to bring the saw blade close to the wood. The shadow of the blade will appear on the wood.
2. Align the pencil line with the edge of the blade's shadow. You may have to adjust the mitre or bevel angles in order to match the pencil line exactly.

Through-Cutting Operations (Fig. A1, A2, O, P)

If the slide feature is not used, ensure the saw head is pushed back as far as possible and the rail lock knob **4** is tightened. This will prevent the saw from sliding along its rails as the workpiece is engaged.

Cutting of multiple pieces is not recommended but can be done safely by ensuring that each piece is held firmly against the table and fence.

Straight Vertical Crosscut

1. Set and lock the mitre arm at zero, and hold the wood firmly on the table **15** and against the fence **11**.
2. With the rail lock knob **4** tightened, turn on the saw by squeezing the trigger switch **22**.
3. When the saw comes up to speed, lower the arm smoothly and slowly to cut through the wood. Let the blade come to a full stop before raising arm.

Sliding Crosscut (Fig. O)

When cutting anything larger than a 51 x 150 mm (51 x 105 mm at 45° mitre) workpiece, use an out-down-back motion with the rail lock knob **4** loosened.

Pull the saw out toward you, lower the saw head down toward the workpiece, and slowly push the saw back to complete the cut.

Do not allow the saw to contact the top of the workpiece while pulling out. The saw may run toward you, possibly causing personal injury or damage to the workpiece.

Mitre Crosscut (Fig. P)

The mitre angle is often 45° for making corners, but can be set anywhere from zero to 50° left or 60° right. Proceed as for a straight vertical crosscut. When performing a mitre cut on workpieces wider than 51 x 105 mm that are shorter in length, always place the longer side against the fence.

Bevel Cut (Fig. A1, A2)

Bevel angles can be set from 49° right to 49° left and can be cut with the mitre arm set between 50° left or 60° right. Refer to the **Features and Controls** section for detailed instructions on the bevel system.

1. Loosen the bevel lock knob **31**, and move the saw to the left or right as desired. It is necessary to move the fence **11** to allow clearance. Tighten the fence adjustment knob **10** after positioning the fences.
2. Tighten the bevel lock firmly.

At some extreme angles, the right or left side fence might have to be removed. Refer to **Fence Adjustment** in the **Adjustments** section for important information on adjusting the fences for certain bevel cuts.

To remove the left or right fence, unscrew the fence adjustment knob **10** several turns and slide the fence out.

Once the bevel operations are completed, reposition the fences.

Quality of Cut

The smoothness of any cut depends on a number of variables, such as the material being cut, blade type, blade sharpness and rate of cut.

When smoothest cuts are desired for molding and other precision work, a sharp (60 tooth carbide) blade and a slower, even cutting rate will produce the desired results.



WARNING: Ensure that the material does not move or creep while cutting; clamp it securely in place. Always let the blade come to a full stop before raising arm. If small fibers of wood still split out at the rear

of the workpiece, stick a piece of masking tape on the wood where the cut will be made. Saw through the tape and carefully remove tape when finished.

Non-Through-Cutting (Grooving and Rabbeting)

Your saw is equipped with a grooving stop **28**, depth adjustment screw **27** and wing nut **26** to allow for groove cutting. Instructions in the **Crosscuts**, **Bevel Cuts** and **Cutting Compound Miters** sections are for cuts made through the full thickness of the material. The saw can also perform non-through cuts to form grooves or rabbets in the material.

Grooving (Fig. A1, A2)

Refer to **Grooving Stop** for detailed instructions for setting depth of cut. A piece of scrap wood should be used to verify the desired depth of cut.

1. Hold the wood firmly on the table and against the fence **11**. Align the cut area underneath the blade. Position the saw arm fully forward, with blade in down position. Turn on the saw by squeezing the trigger switch **22** shown in Figure A2. Smoothly, push saw arm rearward to cut a groove through the workpiece.
2. Release the trigger switch with the saw arm down. When saw blade has completely stopped, raise the saw arm. Always let the blade come to a full stop before raising the arm.
3. To widen the groove, repeat steps 1–2 until the desired width is obtained.

Clamping the Workpiece (Fig. B)

WARNING: A workpiece that is clamped, balanced and secure before a cut may become unbalanced after a cut is completed. An unbalanced load may tip the saw or anything the saw is attached to, such as a table or workbench. When making a cut that may become unbalanced, properly support the workpiece and ensure the saw is firmly bolted to a stable surface. Personal injury may occur.

WARNING: The clamp foot must remain clamped above the base of the saw whenever the clamp is used. Always clamp the workpiece to the base of the saw – not to any other part of the work area. Ensure the clamp foot is not clamped on the edge of the base of the saw.

CAUTION: Always use a work clamp to maintain control and reduce the risk of personal injury and workpiece damage.

Use the material clamp **35** provided with your saw. The left or right fence will slide from side to side to aid in clamping. Other aids such as spring clamps, bar clamps or C-clamps may be appropriate for certain sizes and shapes of material.

To Install Clamp

1. Insert it into the hole behind the fence. The clamp should be facing toward the back of the mitre saw. The groove on the clamp rod should be fully inserted into the base. Ensure this groove is fully inserted into the base of the mitre saw. If the groove is visible, the clamp will not be secure.
2. Rotate the clamp 180° toward the front of the mitre saw.
3. Loosen the knob to adjust the clamp up or down, then use the fine adjust knob to firmly clamp the workpiece.

NOTE: Place the clamp on the opposite side of the base when beveling. ALWAYS MAKE DRY RUNS (UNPOWERED) BEFORE FINISH CUTS TO CHECK THE PATH OF THE BLADE. ENSURE THE CLAMP DOES NOT INTERFERE WITH THE ACTION OF THE SAW OR GUARDS.

Support for Long Pieces (Fig. D)

ALWAYS SUPPORT LONG PIECES.

For best results, use the DE7023-XJ or DE7033 leg stands **37** to extend the table width of your saw. Support long workpieces using any convenient means such as sawhorses or similar devices to keep the ends from dropping.

Cutting Picture Frames, Shadow Boxes And Other Four-Sided Projects (Fig. Q, R)

Try a few simple projects using scrap wood until you develop a “feel” for your saw. Your saw is the perfect tool for mitring corners like the one shown in Figure Q.

Sketch 1 in Figure R shows a joint made with the bevel adjustment method. The joint shown can be made using either method.

- Using bevel adjustment:
 - The bevel for the two boards is adjusted to 45° each, producing a 90° corner.
 - The mitre arm is locked in the zero position and the bevel adjustment is locked at 45°.
 - The wood is positioned with the broad flat side against the table and the narrow edge against the fence.
- Using mitre adjustment:
 - The same cut can be made by mitring right and left with the broad surface against the fence.

Cutting Trim Molding and Other Frames (Fig. R)

Sketch 2 in Figure R shows a joint made by setting the mitre arm at 45° to mitre the two boards to form a 90° corner. To make this type of joint, set the bevel adjustment to zero and the mitre arm to 45°. Once again, position the wood with the broad flat side on the table and the narrow edge against the fence.

The two sketches in Figure R are for four-sided objects only. As the number of sides changes, so do the mitre and bevel angles. The chart below gives the proper angles for a variety of shapes, assuming that all sides are of equal length.

NUMBER OF SIDES	MITRE OR BEVEL ANGLE
4	45°
5	36°
6	30°
7	25.7°
8	22.5°
9	20°
10	18°

For a shape that is not shown in the chart, use the following formula: 180° divided by the number of sides equals the mitre (if the material is cut vertically) or bevel angle (if the material is cut laying flat).


Cutting Compound Mitres (Fig. S)

A compound mitre is a cut made using a mitre angle and a bevel angle at the same time. This is the type of cut used to make frames or boxes with slanting sides like the one shown in Figure S.

WARNING: If the cutting angle varies from cut to cut, check that the bevel lock knob and the mitre lock handle are securely locked. These must be locked after making any changes in bevel or mitre.

The chart shown below will assist you in selecting the proper bevel and mitre settings for common compound mitre cuts.

- Select the desired angle A (Fig. S) of your project and locate that angle on the appropriate arc in the chart.
- From that point follow the chart straight down to find the correct bevel angle and straight across to find the correct mitre angle.
- Set your saw to the prescribed angles and make a few trial cuts. Practise fitting the cut pieces together.

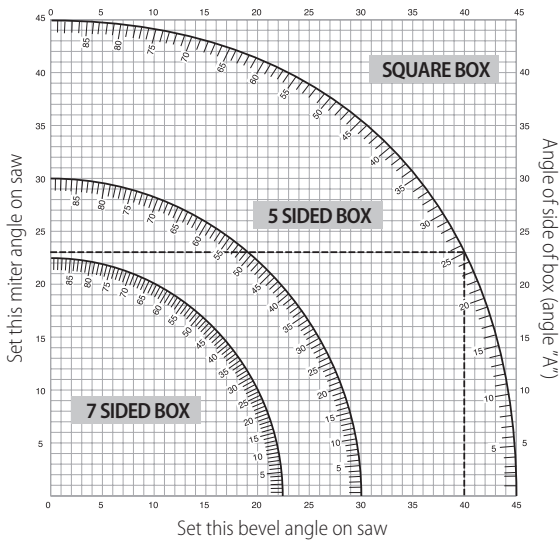

Example: To make a 4-sided box with 26° exterior angles (Angle A, Fig. 5), use the upper right arc. Find 26° on the arc scale. Follow the horizontal intersecting line to either side to get mitre angle setting on saw (42°). Likewise, follow the vertical intersecting line to the top or bottom to get the bevel angle setting on the saw (18°). Always try cuts on a few scrap pieces of wood to verify the settings on the saw.

Cutting Base Moulding (Fig. J, T)

To complete straight 90° cuts, position the wood against the fence and hold it in place as shown in Figure T. Turn on the saw, allow the blade to reach full speed and lower the arm smoothly through the cut.

Cutting Base Moulding from 76 mm up to 171 mm High Vertically Against the Fence (Fig. J, T)

NOTE: Use the slide lock lever **57**, shown in Figure J, when cutting base moulding measuring from 76 mm to 171 mm high vertically against the fence.

Position material as shown in Figure T.

All cuts should be made with the back of the moulding against the fence and with the bottom of the moulding against the table.

	Inside Corner	Outside Corner
Left side	Mitre left 45° Save left side of cut	Mitre right 45° Save left side of cut
Right side	Mitre right 45° Save right side of cut	Mitre left 45° Save right side of cut

Material up to 171 mm can be cut as described above.

Cutting Crown Moulding (Fig. A1, U1, U2)

Your mitre saw is well suited to the task of cutting crown moulding. In order to fit properly, crown moulding must be compound mitred with extreme accuracy.

Your mitre saw has special pre-set mitre latch points at 31.62° left and right for cutting crown moulding at the proper angle and bevel stop pawls at 33.86° left and right. There is also a mark on the bevel scale **8** at 33.9°. The chart below gives the proper settings for cutting crown moulding.

NOTE: Pretesting with scrap material is extremely important!

Instructions for Cutting Crown Moulding Laying Flat and Using the Compound Features (Fig. U1)

- Moulding should lay flat with the broad back surface down on the saw table **15**.
- Place the top of the moulding against the fence **11**.
- The settings below are for 45° sprung crown moulding.

	Inside Corner	Outside Corner
Left side	Bevel left 30° Mitre table set at right 35.26° Save left end of cut	Bevel right 30° Mitre table set at left 35.26° Save left end of cut
Right side	Bevel right 30° Mitre table set at left 35.26° Save right end of cut	Bevel left 30° Mitre table set at right 35.26° Save right end of cut

- The settings below are for crown moulding with 52° angles at the top and 38° angles at the bottom.

	Inside Corner	Outside Corner
Left side	Bevel left 33.9° Mitre table set at right 31.62° Save left end of cut	Bevel right 33.9° Mitre table set at left 31.62° Save left end of cut
Right side	Bevel right 33.9° Mitre table set at left 31.62° Save right end of cut	Bevel left 33.9° Mitre table set at right 31.62° Save right end of cut

Alternative Method for Cutting Crown Moulding

Cutting crown moulding using this method does not require a bevel cut. Minute changes in the mitre angle can be made without affecting the bevel angle. When corners other than 90° are encountered, the saw can be quickly and easily adjusted for them.

Instructions for Cutting Crown Moulding Angled Between the Fence and Base of the Saw for All Cuts (Fig. U2)

- Angle the moulding so the bottom of the moulding (the part which goes against the wall when installed) is against the fence **11** and the top of the moulding is resting on the saw table **15**.
- The angled "flats" on the back of the moulding must rest squarely on the fence and saw table.

	Inside Corner	Outside Corner
Left side	Mitre right at 45° Save right side of cut	Mitre left at 45° Save right side of cut
Right side	Mitre left at 45° Save left side of cut	Mitre right at 45° Save left side of cut

Special Cuts

⚠ WARNING: Never make any cut unless the material is secured on the table and against the fence.

Aluminum Cutting (Fig. V1, V2)

ALWAYS USE THE APPROPRIATE SAW BLADE MADE ESPECIALLY FOR CUTTING ALUMINUM.

Certain workpieces may require the use of a clamp or fixture to prevent movement during the cut. Position the material so that you will be cutting the thinnest cross section, as shown in Figure V1. Figure V2 illustrates the wrong way to cut these extrusions.

Use a stick wax cutting lubricant when cutting aluminum. Apply the stick wax directly to the saw blade **42** before cutting. Never apply stick wax to a moving blade. The wax provides proper lubrication and keeps chips from adhering to the blade.

Bowed Material (Fig. W1, W2)

When cutting bowed material always position it as shown in Figure W1 and never like that shown in Figure W2. Positioning the material incorrectly will cause it to pinch the blade.

Cutting Plastic Pipe or Other Round Material

Plastic pipe can be easily cut with your saw. It should be cut just like wood and **CLAMPED OR HELD FIRMLY TO THE FENCE TO KEEP IT FROM ROLLING**. This is extremely important when making angle cuts.

Cutting Large Material (Fig. X)

Occasionally you will encounter a piece of wood a little too large to fit beneath the lower guard. If this occurs, place your right thumb on the

upper side of the guard ① and roll the guard up just enough to clear the workpiece, as shown in Figure Y. Avoid doing this as much as possible, but if need be, the saw will operate properly and make the bigger cut. NEVER TIE, TAPE, OR OTHERWISE HOLD THE GUARD OPEN WHEN OPERATING THIS SAW.

MAINTENANCE

Your DEWALT power tool has been designed to operate over a long period of time with a minimum of maintenance. Continuous satisfactory operation depends upon proper tool care and regular cleaning.



WARNING: To reduce the risk of injury, turn unit off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure the trigger switch is in the OFF position. An accidental start-up can cause injury.



WARNING: To reduce the risk of serious personal injury, DO NOT touch the sharp points on the blade with fingers or hands while performing any maintenance.

DO NOT use lubricants or cleaners (particularly spray or aerosol) in the vicinity of the plastic guard. The polycarbonate material used in the guard is subject to attack by certain chemicals.



Lubrication

Your power tool requires no additional lubrication.



Cleaning

Before use, carefully check the upper guard, lower guard and dust duct to determine that they will operate properly. Ensure that chips, dust or workpiece particles do not block one of the functions.

In case of workpiece fragments jammed between the saw blade and guards, disconnect the machine from the power supply and follow the instructions given in **Changing or Installing a New Saw Blade**. Remove the jammed parts and reassemble the saw blade.

Periodically clean all dust and wood chips from around AND UNDER the base and the rotary table.



WARNING: Blow dirt and dust out of the main housing with dry air as often as dirt is seen collecting in and around the air vents. Wear approved eye protection and approved dust mask when performing this procedure.



WARNING: Never use solvents or other harsh chemicals for cleaning the non-metallic parts of the tool. These chemicals may weaken the materials used in these parts. Use a cloth dampened only with water and mild soap. Never let any liquid get inside the tool; never immerse any part of the tool into a liquid.

Worklight Cleaning

- Carefully clean sawdust and debris from worklight lens with a cotton swab. Dust build-up can block the worklight and prevent it from accurately indicating the line of cut.
- DO NOT use solvents of any kind; they may damage the lens.
- With blade removed from saw, clean pitch and build-up from blade.

Dust Duct Cleaning (Fig. A1)

With the saw unplugged and the saw head raised fully, low pressure air or a large diameter dowel rod can be used to clear the dust out of the dust duct inlet 18.

Optional Accessories (Fig. B–E)



WARNING: Since accessories, other than those offered by DEWALT, have not been tested with this product, use of such accessories with this tool could be hazardous. To reduce the risk of injury, only DEWALT recommended accessories should be used with this product.

BLADE DESCRIPTIONS

APPLICATION	DIAMETER	TEETH
Construction Saw Blades (<i>thin kerf with anti-stick rim</i>)		
General Purpose	305 mm	32
Fine Crosscuts	305 mm	60
Woodworking Saw Blades (<i>provide smooth, clean cuts</i>)		
Fine Crosscuts	305 mm	80
Non-ferrous Metals	305 mm	96

Consult your dealer for further information on the appropriate accessories.

Protecting the Environment



Separate collection. Products and batteries marked with this symbol must not be disposed of with normal household waste.

Products and batteries contain materials that can be recovered or recycled reducing the demand for raw materials. Please recycle electrical products and batteries according to local provisions. Further information is available at www.2helpU.com.

마이터 쏘 DWS780

축하합니다!

DeWALT 공구를 선택해 주셔서 감사합니다. 제품 개발과 혁신을 통한 다년간의 경험은 DeWALT를 전문 전동 공구 사용자들이 가장 믿을 수 있는 제품으로 만들어 왔습니다.

기술 데이터

		DWS780
전압	V _{AC}	220-240
소비전력	W	1675
톱날 직경	mm	305
톱날 구멍	mm	25.4
톱날 본체 두께	mm	1.8
최대 절단 두께	mm	2.4
최대 톱날 속도	분 ⁻¹	3800
최대 크로스컷 각도 90°	mm	349
최대 마이터 각도 45°	mm	244
최대 절단 깊이 90°	mm	112
최대 베벨 크로스컷 깊이 45°	mm	56
마이터(최대 위치)	좌측	50°
	우측	60°
베벨(최대 위치)	좌측	49°
	우측	49°
0° 마이터		
최대 높이 112 mm에서의 결과 너비	mm	299
최대 높이 110mm에서의 결과 너비	mm	303
최대 너비 345 mm에서의 결과 높이	mm	76
45° 마이터 좌측		
최대 높이 112 mm에서의 결과 너비	mm	200
최대 너비 244 mm에서의 결과 높이	mm	76
45° 마이터 우측		
최대 높이 112 mm에서의 결과 너비	mm	211
최대 너비 244 mm에서의 결과 높이	mm	76
45° 베벨 좌측		
최대 높이 63mm에서의 결과 너비	mm	268
최대 너비 345 mm에서의 결과 높이	mm	44
45° 베벨 우측		
최대 높이 62mm에서의 결과 너비	mm	193
최대 너비 345 mm에서의 결과 높이	mm	28
자동 톱날 제동 시간	s	< 10
무게	kg	25.5



경고: 부상 위험을 줄이려면 사용 설명서를 숙지하십시오.

정의: 안전 지침

다음 정의는 각 경고 문구의 심각도를 설명합니다. 사용 설명서를 읽고 다음 기호들에 유의하십시오.



위험: 절박한 위험 상태를 나타내며, 방지하지 않으면 **사망 또는 심각한 부상을 초래합니다.**



경고: 잠재적 위험 상태를 나타내며, 방지하지 않으면 **사망 또는 심각한 부상을 초래할 수 있습니다.**



주의: 잠재적으로 위험한 상태를 나타내며, 방지하지 않으면 **경미하거나 가벼운 부상을 초래할 수 있습니다.**

참고: 신체 부상을 초래하지 않는 행위를 나타내며, 방지하지 않으면 재산상의 손해가 발생할 수 있습니다.



감전 위험을 나타냅니다.



화재 위험을 나타냅니다.

전동 공구에 관한 일반 안전 경고



경고: 이 전동 공구와 함께 제공되는 모든 안전 경고와 지시사항, 설명 및 사양을 읽으십시오. 아래 설명한 모든 지시사항을 따르지 않으면 감전, 화재 및/또는 심각한 부상을 초래할 수 있습니다.

항후 참고할 수 있도록 모든 경고 및 지시 사항을 보관해두십시오.

경고에서 사용된 "전동 공구"라는 용어는 주 공급 전원에 의해 전기가 공급되는(유선) 전동 공구 또는 충전식(무선) 전동 공구를 의미합니다.

작업장 안전

- 작업장을 항상 청결하고 밝게 유지하십시오. 혼잡하거나 어두운 작업장에서 사고가 발생하기 쉽습니다.
- 가연성 액체, 가스 또는 먼지 등이 있는 폭발성 대기에서 전동 공구를 사용하지 마십시오. 전동 공구에서 먼지나 가스를 발사시킬 수 있는 불꽃이 될 수 있습니다.
- 전동 공구로 작업하는 동안에는 어린이와 주변 사람들이 작업 영역에 가까이 들어오지 못하도록 하십시오. 주변이 산만해져 통제력을 잃을 수 있습니다.

전기 안전

- 전동공구의 플러그는 콘센트와 형식이 일치해야 하며, 플러그를 어떤 형태로든 개조하지 마십시오. 또한 접지된 전동공구에 다른 어댑터 플러그를 사용하지 마십시오. 개조되지 않은 플러그 및 형식이 일치하는 콘센트를 사용하면 감전 위험이 줄어듭니다.
- 파이프 관, 라디에이터, 렌즈, 냉장고 등의 접지 표면에 물이 닿지 않도록 하십시오. 물에 닿을 경우 감전이 될 위험이 높아집니다.
- 전동 공구를 비 또는 습한 환경에 노출하지 않도록 주의하십시오. 전동 공구에 물이 들어가면 감전 위험이 높아집니다.
- 코드를 함부로 다루지 마십시오. 코드를 사용하여 전동 공구를 운반하거나 잡아당기거나 플러그를 뽑지 마십시오. 전열코드가 열기 또는 오일과 접촉되는 것을 피하고, 날카로운 모서리 또는 기기의 기동 부위에 닿지 않도록 주의 하십시오. 코드가 손상되거나 얽혀 있으면 감전 위험이 높아집니다.
- 전동 공구를 실외에서 사용할 때는 실외 사용에 적합한 연장 코드를 사용하십시오. 실외 사용에 적합한 코드를 사용하면 감전 위험이 줄어듭니다.
- 전동공구를 습한 공간에서 사용할 경우, 반드시 누전 차단기(RCD)를 사용하십시오. RCD를 사용하면 감전 위험이 줄어듭니다.

신체 안전 사항

- 전동 공구로 작업할 때는 방심하지 말고 작업에 주의하면서 상식에 따르십시오. 피곤한 상태이거나 약물, 술, 치료제를 복용한 상태에서는 전동 공구를 사용하지 마십시오. 전동 공구를 사용하다 잠깐만 한 눈을 팔아도 심각한 부상을 당할 수 있습니다.
- 신체 보호 장비를 착용하십시오. 항상 보안을 착용하십시오. 적합한 상황에서 방진 마스크, 미끄럼 방지 안전화, 안전모 또는 청력 보호 기구 등의 보호 장비를 사용하면 신체 부상 위험이 줄어듭니다.
- 의도하지 않은 장비 가동 방지, 전원 및/또는 배터리 팩에 연결한 상태로 공구를 선택 또는 운반할 때는 사전에 스위치가 꺼짐 위치에 있는지 반드시 확인하십시오. 스위치가 켜짐 위치에 있는 상태에서 스위치에 손가락이 닿은 상태로 전동 공구를 운반하거나 전동 공구에 전원을 공급하면 사고가 발생합니다.
- 전동 공구를 켜기 전에 모든 조정 키 또는 렌치를 제거하십시오. 전동 공구의 회전 부품에 렌치가 끼가 부착되어 있으면 부상을 당할 수 있습니다.

- e) 무리하게 팔을 뻗지 마십시오. 항상 올바른 자세로 서서 균형을 유지하십시오. 안정된 자세로 작업을 할 경우 전동 공구를 안전하게 사용할 수 있습니다.
- f) 적절한 의복을 착용하십시오. 헐렁한 옷이나 장신구를 착용하지 마십시오. 머리카락과 옷이 움직이는 부품에 닿지 않도록 유의하십시오. 헐렁한 옷, 장신구 또는 긴 머리카락이 움직이는 부품에 걸릴 수 있습니다.
- g) 먼지 배출 및 집진 시설 연결을 위한 장치가 제공된 경우, 이를 장치가 연결되어 적절히 사용되고 있는지 반드시 확인하십시오. 집진 장치를 사용하면 먼지와 관련된 위험을 줄일 수 있습니다.
- h) 장치를 자주 사용함으로써 생긴 익숙함으로 인해 현실에 안주하거나 공구 안전 원칙을 무시하지 않도록 하십시오. 부주의한 작동은 순식간에 심각한 부상을 야기할 수 있습니다.

전동 공구 사용 및 관리

- a) 전동 공구에 무리한 힘을 가하지 마십시오. 해당 용도에 맞는 올바른 전동 공구를 사용하십시오. 올바른 전동 공구를 사용해 설계된 속도로 작업을 더욱 안전하고 정확하게 수행할 수 있습니다.
- b) 스위치 켜짐/꺼짐이 되지 않는 전동 공구는 사용하지 마십시오. 스위치로 제어되지 않는 전동 공구는 위험하므로 수리해야 합니다.
- c) 전동 공구를 조정하거나 액세서리를 변경하거나 보관하기 전에 전동 공구에서 분리되는 경우 전원에서 플러그를 뽑거나 또는 배터리 팩을 분리하십시오. 이러한 예방적 안전 조치를 따라야 전동 공구가 갑자기 작동할 위험이 줄어듭니다.
- d) 사용하지 않는 전동 공구는 어린이의 손이 닿지 않는 곳에 보관하고, 전동 공구나 본 지시 사항에 익숙하지 않은 사람이 전동 공구를 절대 사용하지 못하게 하십시오. 전동공구에 대한 훈련을 받지 않은 사용자가 전동공구를 함부로 다룰 경우 예기치 않은 사고를 초래 할 수 있습니다.
- e) 전동 공구 및 액세서리 유지 보수. 움직이는 부품의 잘못된 정렬이나 바인딩, 부품 파손 및 기타 전동 공구의 작동에 영향을 미칠 수 있는 기타 모든 상태를 확인하십시오. 손상된 부분이 있는 경우 사용하기 전에 전동 공구를 수리하십시오. 많은 사고는 전동 공구를 제대로 유지 보수하지 않아 발생합니다.
- f) 절삭 공구를 예리하고 깨끗한 상태로 유지하십시오. 절삭 가장자리를 예리하게 잘 유지하면 절삭기를 사용할 때 바인딩이 적고 다루기가 용이합니다.
- g) 작업 환경과 수행할 작업을 고려하여, 본 지시 사항에 따라 전동 공구, 액세서리 및 톨 비트 등을 사용하십시오. 본 사용 설명서의 내용과 다른 용도로 전동 공구를 사용하면 위험한 상황이 발생할 수 있습니다.
- h) 핸들과 잡는 표면은 건조하고 깨끗한 상태를 유지하고 오일/기름이 묻지 않도록 하십시오. 미끄러운 핸들과 잡는 면은 예기치 못한 상황에서 안전한 취급과 공구 관리를 보장하지 않습니다.

정비

- a) 자격을 갖춘 기술자가 동일 교체 부품을 사용하여 정비 작업을 수행해야 합니다. 그래야 전동 공구의 안전이 보장됩니다.

마이터 쏘에 대한 안전 지시 사항

- a) 마이터 쏘는 나무 또는 목재 제품을 절단하도록 고안되었으므로, 금속 바, 봉, 스티드 등의 철제 재료를 절단하기 위해 연삭 절단 휠과 함께 사용할 수 없습니다. 연마제 먼지는 하루 가드와 같이 움직이는 부품이 걸리도록 만듭니다. 연삭 절단 시 발생하는 스파크는 하루 가드, 절단 인서트 및 기타 플라스틱 부품을 태울 수 있습니다.
- b) 가능한 클램프를 추가하여 작업물을 지지하십시오. 손으로 작업물을 지지하는 경우, 항상 톨날의 어느 쪽에서든 최소한 100 mm 떨어지도록 유지해야 합니다. 확실히 고정하거나 손으로 잡기에 너무 작은 조각을 절단하는 데 이 톨을 사용하지 마십시오. 손이 톨날에 너무 가까이 놓여 있을 경우, 톨날이 닿아서 부상 당할 위험이 높습니다.
- 3) 작업물은 움직이지 않아야 하는데 클램프로 고정하거나 펜스와 테이블에 대해 고정되어야 합니다. 작업물을 날 속으로 공중하거나 어떤 방식으로든 "맨손으로" 절단하지 마십시오. 제어되지 않거나 움직이는 작업물은 고속에서 날아가 부상을 야기할 수 있습니다.
- d) 억지로 작업물에 톨을 밀어 넣지 마십시오. 톨을 몸 쪽으로 당기면서 작업물을 자르지 마십시오. 절단을 하려면, 톨 헤드를 올리고 작업물 위로 당겨 빼고, 모터를 시동하고, 톨 헤드를 아래로 누른 다음 톨을 작업물 속으로 밀어 넣습니다. 톨을 당기면서 절단하면 톨날이 작업물

위로 올라가도록 야기해 날 애섬블리가 작업자 쪽으로 격렬하게 날아갈 수 있습니다.

- e) 톨날의 앞쪽 또는 뒤쪽 어느 쪽이든 의도한 절단 선 위에서 절대 손을 교차하지 마십시오. 왼손으로 톨날의 오른쪽으로 작업물을 잡고 있는 등(또는 그 반대로) "손을 교차시켜" 작업물을 지지하면 매우 위험합니다.
- f) 날이 돌아가고 있는 동안 어떠한 이유에서든 톨날의 어느 쪽으로부터 100 mm 보다 더 가까이에서 손으로 펜스 뒤쪽을 잡지 마십시오. 돌아가는 톨날이 손에 근접한 정도는 한 눈에 보이지 않을 수 있으므로 심각하게 부상당할 수 있습니다.
- g) 절단 전에 작업물을 검사하십시오. 작업물이 굽었거나 비틀어진 경우, 펜스 쪽을 향해 바깥쪽으로 굽게 힘으로 고정하십시오. 항상 절단선에 따라 작업물, 펜스 및 테이블 사이에 틈이 없는지 확인하십시오. 구부러지거나 흰 작업물은 구부러지거나 이동할 수 있어서 절단 시 회전 톨날에서 바인딩을 야기할 수 있습니다. 작업물에 스펀지나 이물질이 없어야 합니다.
- h) 테이블에 작업물을 제외하고 모든 공구, 나무 조각 등이 없이 깨끗한 상태에서만 톨을 사용하십시오. 회전하는 날과 닿는 목재 또는 기타 물체의 작은 파편 또는 험거운 조각은 고속에서 날아갈 수 있습니다.
- i) 한 번에 한 개의 작업물만 절단하십시오. 진득 쌓인 여러 개의 작업물은 제대로 고정하거나 보강할 수 없으므로 절단 중에 날이 엉키거나 이동될 수 있습니다.
- j) 사용 전에 마이터 쏘가 평평하고 단단한 작업면에 장착되어 놓여 있는지 확인하십시오. 평평하고 단단한 작업면은 마이터 쏘가 불안정해질 위험을 줄여줍니다.
- k) 작업 계획을 세우십시오. 베벨 또는 마이터 각도 설정을 변경할 때마다, 작업물을 지지할 수 있는 펜스를 적절하게 설정하고 톨날 또는 안전을 위한 기능들의 작동을 방해하지 않는지 확인하십시오. 공구를 "켜지" 않고 테이블 위에 작업물이 없는 상태에서, 톨날을 전체 가상 절단을 통과하는 것처럼 이동해서 펜스 절단 시 방해하는 것이나 위험이 없는지 확인하십시오.
- l) 테이블 상단보다 더 넓거나 더 긴 작업물의 경우 테이블을 연장대, 튜빙용 작업대 등으로 적절한 지지를 하십시오. 마이터 쏘보다 더 길거나 더 넓은 작업물은 단단히 지지되지 않으면 기울어질 수 있습니다. 절단 조각 또는 작업물이 기울어질 경우, 하드 가드를 들어올리거나 돌아가는 날에 의해 날아갈 수 있습니다.
- m) 테이블 확장대 또는 추가 지지대의 대체물로 다른 사람을 사용하지 마십시오. 작업물이 불안정하게 지지되면 날이 바인딩되거나 작업물이 절단 작업 동안 이동되어 작업자와 도와주는 사람을 돌아가는 날 속으로 끌어 넣을 수 있습니다.
- n) 절단 조각은 어떻게 해서든 돌아가는 톨날에 걸리거나 놀려서는 안됩니다. 길이 멈춤을 사용하는 등 제한되어 있는 경우, 절단 조각이 톨날에 끼어서 격렬하게 날아갈 수 있습니다.
- o) 항상 봉이나 관 등 둥근 재료를 적절히 지지하도록 설계된 절치나 고정장치를 사용하십시오. 봉은 절단되는 동안 돌아가는 경향이 있어서 날이 "파고들게" 하고 손으로 잡은 작업물이 날 속으로 당겨질 수 있습니다.
- p) 톨날이 작업물에 닿기 전에 최대 속도에 도달하도록 하십시오. 이는 작업물이 날아갈 위험을 줄여줍니다.
- q) 작업물이나 날이 걸릴 경우, 마이터 쏘를 끄십시오. 모든 움직이는 부품이 정지할 때까지 기다렸다가 전원 장치에서 플러그를 뽑거나 배터리 팩을 분리하십시오. 그런 다음 걸린 재료를 빼는 작업을 하십시오. 걸린 작업물에 계속해서 톨질을 하면 제어력을 잃거나 마이터 쏘가 손상될 수 있습니다.
- r) 절단을 마친 후에는, 스위치에서 손을 떼고, 톨 헤드를 아래로 잡고 절단 조각 제거기 전에 톨날이 멈출 때까지 기다리십시오. 타성으로 움직이는 날 가까이에 손을 놓으면 위험합니다.
- s) 불안정한 절단을 하거나 톨 헤드가 완전히 아래 위치에 있기 전에 스위치를 놓을 때는 핸들을 꼭 잡으십시오. 톨의 제동 조치는 톨 헤드가 급작스럽게 아래쪽으로 당겨질 수 있도록 하여 부상 위험이 있습니다.

마이터 쏘에 대한 추가 안전 규칙



경고: 전체 설명서를 숙지할 때까지 장치에 주 전원 장치를 연결하지 마십시오.

- 설명서에 따라 기계가 완전하게 조립되고 설치될 때까지 기계를 작동하지 마십시오. 부정확하게 조립된 기계는 심각한 부상을 초래할 수 있습니다.

- 이 기계 작동법을 완전히 숙지하지 못한 경우 감독관, 강사 또는 다른 유지격자로부터 **조언을 구하십시오**. 알고 있는 것이 안전을 지키는 길입니다.
- 톱날이 정확한 방향으로 돌아가는지 **확인하십시오**. 톱니는 톱에 표시된 회전 방향을 가리켜야 합니다.
- 작동 전에 **모든 클램프 핸들, 노브 및 레버를 조입니다**. 클램프가 헐거우면 부품이나 작업물이 고속에서 날아갈 수 있습니다.
- 모든 톱날과 톱날 클램프는 깨끗하고, 톱날 클램프의 들어간 쪽이 톱날에 맞대어 있어야 하고 주축 나사가 단단히 조여져 있는지 **확인하십시오**. 풀리거나 잘못된 톱날 클램핑은 톱 손상 및 부상을 초래할 수 있습니다.
- 톱에 **지정된 전압 이외의 어떤 것에서 작동하지 마십시오**. 과열, 공구 손상 및 부상이 발생할 수 있습니다.
- 모터 축을 고정하는 **팬에 어떤 것도 끼워 넣지 마십시오**. 공구 손상 및 부상이 발생할 수 있습니다.
- 절대 신체의 일부가 톱날의 경로와 일치하지 않도록 하십시오**. 부상이 발생할 수 있습니다.
- 돌아가는 날에 톱날 윤회율을 바르지 마십시오**. 윤회율을 바르면 손이 톱날 속으로 이동할 수 있어서 심각한 부상을 입을 수 있습니다.
- 톱이 전원 장치에 연결되어 있을 때는 톱날 부근에 손을 두지 **마십시오**. 부주의한 날 작동은 심각한 부상을 초래할 수 있습니다.
- 톱날 주변 또는 뒤쪽에 손을 대지 마십시오**. 날로 인해 심각한 부상을 입을 수 있습니다.
- 톱을 끄지 않고 플러그를 뽑지 않은 경우 **톱 아래에 들어가지 마십시오**. 톱날에 닿아 심각한 부상을 입을 수 있습니다.
- 안정된 지지 표면에 기계를 고정하십시오**. 진동이 발생하면 기계가 미끄러지거나, 이동하거나 뒤집어져서 심각한 부상을 초래할 수 있습니다.
- 마이터 쏘용으로 권장하는 **크로스컷 톱날만 사용하십시오**. 최상의 결과를 위해, 7도를 넘는 후크 각도로 되어 있는 카비드 텅 날을 사용하지 마십시오. 깊은 걸릿이 있는 날을 사용하지 마십시오. 이러한 날은 방향을 바꾸어 가드에 닿을 수 있으므로 기계 손상 및/또는 심각한 부상을 야기할 수 있습니다.
- 기계 손상 및/또는 심각한 부상을 방지하려면 이 공구에 **지정된 정확한 크기 및 유형의 날만 사용하십시오**(EN847-1 준수).
- 작동 전에 날에 균열**이나 기타 손상이 없는지 검사하십시오. 금이 가거나 손상된 날은 부서질 수 있고 고속에서 조각이 날아가 심각한 부상을 입을 수 있습니다. 금이 가거나 손상된 톱날은 즉시 교체하십시오. 톱날의 최대 속도 지점을 준수하십시오.
- 작동 전에 **날과 날 클램프를 청소하십시오**. 톱날과 톱날 클램프를 청소하면 톱날이나 톱날 클램프에 대한 손상을 점검할 수 있습니다. 금이 가거나 손상된 날 또는 날 클램프는 부서질 수 있고 고속에서 조각이 날아가 심각한 부상을 입을 수 있습니다.
- 톱날의 최대 속도는 항상 공구의 명판에 지정되어 있는 속도 이상이거나 최소한 같아야 합니다**.
- 톱날 직경은 공구 명판의 표시를 따라야 합니다**.
- 휘어진 날을 사용하지 마십시오**. 톱날이 정확하게 돌아가고 흔들림이 없는지 확인해 보십시오. 톱날이 진동하면 기계 손상 및/또는 심각한 부상을 초래할 수 있습니다.
- 플라스틱 가드 부근에서 윤회율 또는 클리너(특히 스프레이 또는 연유제)를 사용하지 **마십시오**. 가드에 사용된 폴리카보네이트 물질은 특정 화학물질에 의해 손상될 수 있습니다.
- 가드를 제자리에 놓고 작업 순서를 지키십시오**.
- 항상 절단판을 사용하고 손상되었으면 이 절단판을 교체하십시오**. 톱 밑에 작은 파편 축적물은 톱날에 방해가 되거나 절단 시 작업물을 불안정하게 만들 수 있습니다.
- 기계 손상 및/또는 심각한 부상을 방지하려면 이 공구에 **지정된 톱날 클램프만 사용하십시오**.
- 반드시 절단할 재료에 맞는 정확한 톱날을 선택하십시오**.
- 부스러기와 톱밥이 없도록 **모터 에어 슬롯을 청소하십시오**. 모터 에어 슬롯이 막혀 있으면 기계가 과열되어, 기계가 손상되고 심각한 부상을 야기할 수 있는 단락을 초래할 수 있습니다.
- 절대로 스위치가 "켜짐" 위치에 있는 상태에서 잠그지 마십시오**. 심각한 부상을 당할 수 있습니다.
- 공구 위에 절대로 서 있지 마십시오**. 공구가 젖혀지거나 절삭 공구가 고의 아니게 접촉될 경우 심각한 부상을 입을 수 있습니다.



경고: 플라스틱, 수액 코팅 목재 및 기타 재료를 절단하면 녹은 재료가 날 톱과 톱날 몸체에 축적되어, 절단 시 날이 과열되고 비인된 될 위험이 증가합니다.



경고: 항상 적절한 청력 보호 장구를 착용하십시오. 특정 상황 하에서 제품 사용 기간과 제품에서 발생하는 소음은 청력 손상에 영향을 줄 수 있습니다. 소음 노출에 영향을 주는 다음과 같은 요소를 알고 계십시오.

- 발생하는 소음을 줄이도록 고안된 톱날을 사용할 것.
- 충분히 날카로운 톱날만 사용할 것, 그리고
- 특수하게 설계된 소음 감소 톱날을 사용하십시오.



경고: 항상 보안경을 착용하십시오. 일상적으로 쓰는 안경은 보호 안경이 아닙니다. 또한 절단 작업 시 먼지가 생길 경우에는 안면 마스크나 방진 마스크를 착용하십시오.



경고: 본 공구의 사용으로 인해 발생하거나 비산하는 먼지는 심각한 영구 호흡기 손상 또는 기타 손상을 초래할 수 있습니다.



경고: 전동 샌딩, 절삭, 연마, 드릴 및 기타 건설 작업에 의해 발생하는 일부 분진에는 암, 선천적 결손증 또는 다른 생식기 손상을 초래하는 것으로 알려진 화학물질이 함유되어 있습니다. 이러한 화학물질의 몇 가지 예는 다음과 같습니다.

- 납 성분 페인트에 함유된 납,
- 벽돌과 시멘트 및 기타 석재 제품에 함유된 결정질 실리카
- 화학 처리된 목재에 함유된 비소와 크롬.

이러한 노출에 따른 위험은 해당 류의 작업을 수행하는 빈도에 따라 다릅니다. 이러한 화학물질에 대한 노출을 줄이려면. 환기가 잘 되는 장소에서 작업하고, 미세 입자를 걸러내도록 특수 설계된 방진 마스크 등 승인된 안전 장구를 사용해서 작업해야 합니다.

- 전동 샌딩, 연마, 드릴 및 기타 건설 작업에 의해 발생하는 분진에 장시간 노출되지 않도록 하십시오**. 보호복을 착용하고 노출된 부위를 비눗물로 씻으십시오. 분진이 입이나 눈에 들어가거나 피부에 묻으면 해로운 화학물질이 체내로 쉽게 흡수될 수 있습니다.



경고: 본 공구의 사용으로 인해 발생하거나 비산하는 먼지는 심각한 영구 호흡기 손상 또는 기타 손상을 초래할 수 있습니다. 항상 미세 입자용으로 승인된 호흡기 보호 장구를 사용하십시오.

기타 발생 가능한 위험

다음 위험들은 톱 사용 시 내재하고 있습니다.

- 돌아가는 부품을 만짐으로 인해 발생하는 부상.
- 관련된 안전 규정을 준수하고 안전 장치를 사용한다고 해도 특정한 위험은 피할 수 없습니다. 이러한 위험은 다음과 같습니다.
- 청력 손상.
- 돌아가는 톱날의 덮여 있지 않은 부품으로 인한 사고의 위험.
- 톱날 교체 시의 부상 위험.
- 가드를 열 때 손가락이 눌리는 위험.
- 나무, 특히, 오크, 너도밤나무 및 MDF를 톱질할 때 발생하는 먼지를 호흡함으로써 초래되는 건강 상의 위험.

다음과 같은 요인은 호흡 문제의 위험을 증가시킵니다.

- 나무를 톱질할 때 연결된 먼지 제거기가 없음.
- 깨끗하지 않은 배기 필터로 인한 불충분한 먼지 추출.

전기 안전

전기 모터는 한 가지 전압에만 맞추어 설계되었습니다. 전원이 전동구 리튬에 기재된 전압과 일치하는지 항상 확인하십시오.



DEWALT 공구는 IEC62841에 따라 이중 절연되어 있으므로 접지선이 필요 없습니다.

전원 코드가 손상된 경우에는 DEWALT 또는 공인 서비스 센터를 통해서만 교체해야 합니다.

연장 케이블 이용

연장 케이블이 필요할 경우 이 공구의 소비전력에 맞는 승인된 3 코어 연장 케이블을 사용하십시오(**기술 데이터** 참조). 최소 도체 크기는 1.5 mm², 최대 길이는 30 m입니다.

케이블 릴을 사용할 때는 항상 케이블을 완전히 푸십시오.







포장 내용물

포장에는 다음 내용물이 들어 있습니다.

- 1 조립된 마이터 쏘
- 2 베이스 연장부 및 설치 하드웨어
- 1 날 렌치(그림 A2의 설치 참조)
- 1 톱날
- 1 먼지주머니
- 1 작업물 고정대
- 1 사용 설명서
- 운반 중에 발생할 수 있는 공구, 부품 또는 액세서리의 손상 여부를 확인하십시오.
- 작동 전에 시간을 내어 본 사용 설명서를 읽고 숙지하십시오.

공구에 표시된 마크

공구에는 다음과 같은 그림이 있습니다.

-  사용 전에 사용 설명서의 내용을 숙지하십시오.
-  귀 보호 장구를 착용하십시오.
-  보안경을 착용하십시오.
-  톱날이 닿지 않는 쪽에 손을 두십시오.
-  손은 톱날의 어느 쪽에서든 100 mm 거리를 유지하십시오.
-  광원을 직접 쳐다보지 마십시오.



이동 지정.

날짜 코드 위치(그림 A1)

날짜 코드 6 에는, 제조년도가 포함되어 이 제조년도는 케이스에 인쇄되어 있습니다.

예:

2010 XX XX
제조년도

설명(그림 A1-E)


 **경고:** 전동 공구 또는 전동 공구의 어떤 부품도 절대 개조하지 마십시오. 제품이 파손되거나 신체 부상을 당할 수 있습니다.

그림 A1

- 1 하부 가드
- 2 작동 핸들
- 3 운반용 핸들
- 4 레일 잠금 노브
- 5 레일 고정 나사 조정
- 6 날짜 코드
- 7 레일
- 8 베벨 눈금
- 9 내려 잠금 핀
- 10 펜스 조정 노브
- 11 펜스
- 12 베이스 펜스
- 13 베이스 연장부 핸들
- 14 손 자국 표시
- 15 테이블

- 16 작업대 장착 구멍
- 17 마이터 눈금
- 18 먼지 배관 입구
- 19 마이터 잠금 핸들
- 20 마이터 래치 버튼
- 21 절단판
- 22 트리거 스위치
- 23 락오프 레버
- 24 자물쇠 구멍
- 25 XPS 커짐/꺼짐 스위치
- 26 윈너트
- 27 깊이 조정 나사
- 28 그루빙 스톱
- 29 날 렌치
- 30 베이스
- 31 베벨 잠금 노브
- 32 0° 베벨 스톱 오버라이드
- 33 집진 장치 포트
- 34 벨트 커버
- 35 작업물 클램프(그림 B)

그림 A2

- 36 DW7053-XJ 먼지주머니
- 37 DE7023-XJ / DE7033-XJ 레그 스탠드
- 38 DE7025-XJ 클램프 브래킷

선택 액세서리

그림 C

- 36 DW7053-XJ 먼지주머니

그림 D

- 37 DE7023-XJ / DE7033-XJ 레그 스탠드

그림 E

- 38 DE7025-XJ 클램프 브래킷


용도

DEWALT DWS780 마이터 쏘는 나무, 목제품 및 플라스틱을 전문적으로 절단하도록 고안되었습니다. 적절한 톱날을 사용하면, 알루미늄 톱질도 가능합니다. 본 전동공구는 교차절단, 베벨링 및 마이터링을 쉽고, 정확하고 안전하게 수행할 것입니다.

이 공구는 공칭 날 직경 305 mm의 초경 팁 날과 함께 사용하도록 고안되었습니다. 습한 환경이나 가연성 액체 또는 가스가 있는 장소에서 사용하지 **마십시오**.


이 마이터 쏘는 전문적인 전동 공구입니다.

어린이가 이 공구를 만지지 **않도록 하십시오**. 경험이 없는 작업자가 이 공구를 사용할 때는 감독자의 지도가 필요합니다.

 **경고:** 의도한 용도 이외의 목적으로 기계를 사용하지 마십시오.

- 본 제품은 안전 책임을 맡고 있는 사람이 감독을 하고 있지 않는 환경, 지식 또는 기술이 부족하고 신체적, 감각적 또는 정신적 능력이 미약한 사람(어린이 포함)이 사용하도록 고안된 것이 아닙니다. 이 제품과 함께 어린이만 혼자 두어서는 안됩니다.

조립 및 조정

 **경고:** 액세서리를 설치 및 제거하기 전, 구성 상태를 조정하거나 변경하기 전, 또는 수리 시 부상의 위험을 줄이려면 장치를 끄고 전원에서부터 연결을 차단하십시오. 트리거 스위치가 꺼진 위치에 있는지 반드시 확인하십시오. 공구가 갑자기 작동하여 부상을 당할 수 있습니다.

포장 풀기(그림 A1, F)

1. 그림 F와 같이 상자를 열고 편리한 이동 핸들 3 을 사용하여 톱을 들어 올립니다.
2. 매끄럽고 평평한 면에 톱을 놓습니다.
3. 레일 잠금 노브 4 를 풀고 톱 헤드를 뒤로 돌려 뒤쪽에 고정되도록 합니다.
4. 작동 핸들 2 을 살짝 눌러 내려 잠금 핀 9 을 당겨 뺍니다.
5. 부드럽게 하방 압력을 풀고 작동 핸들을 잡고 최대 높이까지 올라가도록 합니다.

작업대 장착(그림 A1)

벤치 장착을 쉽게 할 수 있도록 네 개의 모든 발에 구멍 **16** 이 제공되어 있습니다. 두 개의 다른 크기의 구멍은 다른 크기의 나사를 끼우기 위한 것입니다. 어느 쪽이든 구멍 하나를 사용합니다. 두 개를 사용할 필요가 없습니다.

항상 톱을 안정된 표면에 단단히 장착하여 흔들리지 않도록 하십시오. 공구의 이동성을 향상시키기 위해, 이 전동공구는 작업 지지대에 칠 수 있는 혹은 다른 작업대로 옮기거나 다시 칠 수 있는 12.7mm 두께 이상의 합판 조각에 고정할 수 있습니다.

참고: 톱을 합판 조각에 장착하기로 한 경우 설치나사가 나무의 아래쪽에서 튀어나오지 않도록 하십시오. 합판은 작업 지지대와 수평을 이루도록 장착되어야 합니다. 작업 표면에 톱을 칠 때 설치나사 구멍이 있는 조임돌기에만 조이십시오. 다른 지점에서 조이면 톱이 제대로 작동하는데 방해가 됩니다.

! 주의: 목기거나 부장화하지 않도록 고정 표면이 휘거나 울퉁불퉁하지 않도록 확인하십시오. 톱이 흔들릴 경우 톱이 장착면에 확실히 장착될 때까지 한 개의 톱못 아래에 얇은 조각을 대십시오.

절단판 교체(그림 A1)

절단판 **21** 을 제거하려면, 절단판을 제자리에 고정하고 있는 나사를 제거하고 새 것으로 교체합니다.

다음과 같은 순서, 즉 먼저 끝에서 중간쯤에 위치한 동근 구멍을 통과한 다음 끝에 있는 슬롯을 통해 나사를 다시 조립합니다. 조정이 필요하지 않습니다.

베이스 연장부 조립(그림 Y)

! 경고: 톱을 사용하기 전에 톱의 베이스 양쪽에 베이스 연장부를 조립해야 합니다.

! 경고: 톱의 베이스와 수평이 되도록 장착 슬롯을 사용하여 베이스 연장부를 조정하십시오.

1. 베이스 측면에서 손 자국 표시 **14** 위에 있는 구멍을 찾습니다.
2. 육각 렌치를 사용하여, 와서 **59**, 베이스 연장부 **13** 을 통한 다음 베이스의 구멍 속에 나사 **58** 를 장착합니다.
3. 움직이지 않는지 확인하려면 연장부를 당겨보으로써 연장부가 고정되었는지 확인합니다.
4. 다른 쪽에서 1~3 단계를 반복합니다.

참고: 작업물이 반듯하게 놓여 있도록 연장부가 작업 표면과 높이가 같으리 확인하십시오. 일직선 작업물에는 작업물과 베이스 연장부 사이에 틈이 없어야 합니다.

새 톱날 교환 또는 설치

! 경고: 신체 부상의 위험을 줄이려면 톱날을 취급할 때는 장갑을 착용하십시오.

! 경고: 액세서리를 설치 및 제거하기 전, 구성 상태를 조정하거나 변경하기 전, 또는 수리 시 부상의 위험을 줄이려면 장치를 끄고 전원으로부터 연결을 차단하십시오. 트리거 스위치가 꺼짐 위치에 있는지 반드시 확인하십시오. 공구가 갑자기 작동하여 부상을 당할 수 있습니다.

- 날이 전원 또는 관성으로 움직이는 동안에는 스펀들 잠금 버튼을 절대로 누르지 마십시오.
- 이 마이터 쏘를 사용하여 경합금과 철금속(쇠 또는 강) 또는 석조 또는 섬유조직의 시멘트 제품을 절단하지 마십시오.

톱날 제거하기(그림 G1-G4)

1. 톱의 플러그를 뽑니다.
2. 암을 상부 위치까지 들어올리고 하부 가드 **1** 를 최대한 멀리 올립니다.
3. 풀도 브라켓 **61** 이 날 나사 **39** 에 접근할 수 있게 충분히 멀리 올릴 수 있을 때까지 가드 브라켓 나사 **62** 를 제거하지 마십시오. 하부 가드는 가드 브라켓 나사의 위치로 인해 올려진 상태로 유지됩니다.
4. 잠길 때까지 손으로 톱날 **42** 을 조심스럽게 돌리는 동안 스펀들 잠금 버튼 **40** 을 누릅니다.
5. 버튼을 누른 상태에서 다른 손과 제공된 렌치 **29** 를 사용해 날의 나사를 풀니다. (좌측의 나삿니를 시계 방향으로 돌립니다.)
6. 날 나사 **39**, 외부의 클램프 와셔 **41**, 날 **42** 및 날 어댑터 **60** 를 제거합니다 (사용한 경우). 안쪽의 클램프 와셔 **43** 는 스펀들에서 남아 있을 수 있습니다.

참고: 15.88 mm (5/8")의 톱날 구멍이 있는 톱날의 경우 25.4 mm (1") 톱날 어댑터 **60** 는 사용되지 않습니다.

톱날 설치하기(그림 G1-G4)

1. 톱의 플러그를 뽑니다.
2. 암을 올리고 하부 가드 및 가드 브라켓을 열어 놓은 상태에서 **61**, 톱의 뒤쪽을 가리키는 날의 하단부에 있는 톱니로 안쪽의 날 클램프 쪽으로 스펀들과 날 어댑터(1" [25.4 mm] 직경의 날 구멍이 있는 날을 사용하는 경우)에 날을 놓습니다.
3. 스펀들에 외부의 클램프 와셔 **41** 를 조립합니다.
4. 날 나사 **39** 를 설치하고 스펀들 잠금을 작동하면서 제공된 렌치로 나사를 단단히 조입니다(좌측의 나삿니를 시계 반대 방향으로 돌립니다).

참고: 날 구멍의 직경이 5/8" (15.88 mm)인 날을 사용할 때는, 날 어댑터가 사용되지 않으므로 나중에 사용할 수 있도록 안전한 곳에 보관해 두십시오. 모든 모델에 별도의 날 어댑터를 사용할 수 없습니다.

5. 톱날 브라켓을 원래 위치로 돌리고 톱날 브라켓 나사를 단단히 조여서 브라켓을 제자리에 고정합니다.

! 경고:

- 톱을 작동시키기 전에 가드 브라켓을 원래 위치로 되돌려야 하고 가드 브라켓 나사를 조여야 합니다. 그렇게 하지 않으면 가드가 돌아가는 톱날에 닿아서 톱이 손상되고 심각한 부상을 당할 수 있습니다.

톱 이동하기(그림 A1, A2)

! 경고: 심각한 신체 부상의 위험을 줄이려면, 항상 톱을 이동하기 전에 레일 잠금 노브, 마이터 잠금 핸들, 베벨 잠금 핸들, 내려 잠금 핀과 펜스 조정 노브를 잠그십시오 이동하거나 들어 올리기 위해 가드를 사용하지 마십시오.

마이터 쏘를 편리하게 가지고 다니려면 톱 암의 상부에 이동 핸들 **3** 이 포함되어 있어야 합니다.

- 톱을 이동하려면 헤드를 내리고 내려 잠금 핀 **9** 을 누릅니다.
- 레일 잠금 노브와 전면에 있는 톱 헤드를 잠그고, 마이터 암을 최대 좌측 마이터 각도로 잠그고, 펜스 **11** 를 안쪽으로 완전히 밀고, 베벨 잠금 노브 **31** 를 수직 위치의 톱 헤드와 함께 잠겨 공구가 최대한 간편하도록 만듭니다.
- 항상 이동 핸들 **3** 또는 손 자국 표시 **14** 를 사용하십시오.

기능 및 컨트롤

! 경고: 액세서리를 설치 및 제거하기 전, 구성 상태를 조정하거나 변경하기 전, 또는 수리 시 부상의 위험을 줄이려면 장치를 끄고 전원으로부터 연결을 차단하십시오. 트리거 스위치가 꺼짐 위치에 있는지 반드시 확인하십시오. 공구가 갑자기 작동하여 부상을 당할 수 있습니다.

마이터 제어(그림 H)

마이터 잠금 핸들 **19** 과 마이터 래치 버튼 **20** 을 통해 톱을 우측 60° 및 좌측 50°까지 마이터링할 수 있습니다. 톱을 마이터링하려면 마이터 잠금 핸들을 올리고, 마이터 래치 버튼을 누르고 마이터 눈금 **17** 에서 원하는 마이터 각도를 설정합니다. 마이터 각도를 잠그려면 마이터 잠금 핸들을 밀어 내립니다.

베벨 잠금 노브(그림 A2)

베벨 잠금을 통해 톱을 49° 좌측 또는 우측으로 베벨링할 수 있습니다. 베벨 설정을 조정하려면, 베벨 잠금 노브 **31** 를 시계 반대 방향으로 돌립니다. 0° 베벨 오버라이드 노브를 끌어 당기면 톱 헤드가 좌우로 쉽게 베벨링됩니다. 조이려면, 베벨 잠금 노브를 시계 방향으로 돌립니다.

0° 베벨 오버라이드(그림 A2)

0° 베벨 스톱 오버라이드 **32** 를 통해 톱을 0° 표시를 지나 우측으로 톱을 베벨링할 수 있습니다.

작동되면 좌측에서 시작한 경우 톱이 자동으로 0°에서 정지합니다. 임의로 0°를 지나 우측으로 이동하려면, 베벨 스톱 오버라이드 **32** 를 당깁니다. 손을 놓으면 오버라이드가 다시 작동됩니다. 베벨 스톱 오버라이드는 노브를 180° 돌려서 잠글 수 있습니다.

0°에 있으면 오버라이드가 제자리에서 잠깁니다. 오버라이드를 작동하려면 톱을 좌측으로 약간 기울입니다.

45° 베벨 스톱 오버라이드(그림 I)

톱의 양쪽에 하나씩 두 개의 베벨 스톱 오버라이드 레버가 있습니다. 톱을 좌측 또는 우측, 45°를 지나 베벨링하려면, 45° 베벨 오버라이드 레버 **50** 를 뒤쪽으로 밀니다. 뒤쪽에 있을 때 이러한 정지점을 지나 베벨링할 수 있습니다. 45° 정지가 필요할 경우 45° 베벨 오버라이드 레버를 앞쪽으로 당깁니다.

크라운 베벨 멈춤쇠(그림 I)

크라운 물딩을 평평하게 놓고 절단할 때, 톱이 크라운 스톱, 좌우를 정확하고 빠르게 설정할 수 있도록 되어 있습니다.(크라운 물딩을 평평하게 놓고 절단 및 복합 기능 사용에 대한 지침을 참조하십시오).

크라운 베벨 멈춤쇠 52 를 돌려 크라운 조정 나사와 맞닿게 할 수 있습니다.

크라운 베벨 멈춤쇠를 뒤바꾸려면, 고정 나사, 22.5° 베벨 멈춤쇠 51 와 30° 크라운 베벨 멈춤쇠 52 를 제거합니다. 33.86° 문구가 위를 향하도록 크라운 베벨 멈춤쇠 52 를 돌립니다. 나사를 다시 장착하여 22.5°베벨 멈춤쇠와 크라운 베벨 멈춤쇠를 고정합니다. 정확도 설정에는 영향을 주지 않습니다.

22.5° 베벨 멈춤쇠(그림 I)

톱은 22.5° 베벨, 좌측 또는 우측을 빠르고 정확하게 설정하도록 되어 있습니다. 22.5° 베벨 멈춤쇠 51 를 돌려 크라운 조정 나사 49 와 맞닿게 할 수 있습니다.

레일 잠금 노브(그림 A1)

레일 잠금 노브 4 를 통해 레일 7 에서 미끄러지지 않도록 톱 헤드를 단단히 잠글 수 있습니다. 이는 절단을 하거나 톱을 운반할 때 필요합니다.

그루빙 스톱(그림 A2)

그루빙 스톱 28 을 통해 날의 절단 깊이를 제한할 수 있습니다. 이 스톱은 그루빙과 큰 수직 절단 등의 용도에 유용합니다. 그루빙 스톱을 앞쪽으로 돌리고 깊이 조정 나사 27 를 조정해 원하는 절단 깊이를 설정합니다. 조정을 고정하려면 원 너트 26 를 조입니다. 그루빙 스톱을 톱의 뒤쪽으로 돌리면 그루빙 스톱 기능을 건넵니다. 깊이 조정 나사가 손으로 풀기에 너무 조여진 경우 제공된 날 렌치 29 를 사용하여 나사를 풀 수 있습니다.

내려 잠금 핀(그림 A1)

경고: 내려 잠금 핀은 톱을 들고 다니거나 보관할 때만 사용해야 합니다. 절단 작업 중에는 내려 잠금 핀을 절대로 사용하지 않습니다.

톱 헤드를 내린 위치로 잠그려면 톱 헤드를 아래로 밀고, 내려 잠금 핀 9 을 안으로 누르고 톱 헤드를 풀니다. 이렇게 하면 톱을 여기저기로 이동 시 톱 헤드가 안전하게 아래쪽에 고정됩니다. 풀려면 톱 헤드를 아래로 누르고 핀을 당겨 뺍니다.

슬라이드 잠금 레버(그림 J, T)

슬라이드 잠금 레버 57 는 그림 T와 같이 수직으로 절단할 때 톱을 한 위치에 있게 하여 베이스 물딩의 절단을 극대화합니다.

조정

마이터 쓰는 공장 출고 시 최대한 정확하게 조정되어 있습니다. 발송 또는 다른 이유로 인해 재조정이 필요할 경우, 아래의 설명에 따라 톱을 조정하십시오. 일단 했으면, 이 조정은 정확하게 유지되어야 합니다.

마이터 눈금 조정(그림 H, K)

1. 마이터 잠금 핸들 19 의 잠금을 풀고 마이터 래치 버튼 20 이 0° 마이터 위치에 잠길 때까지 마이터 암을 흔듭니다. 마이터 눈금 핸들을 잠그지 마십시오.
2. 그림 K와 같이 톱의 펜스와 날이 직각이 되도록 놓으십시오. (직각자로 톱의 끝을 건드리지 마십시오. 측정이 부정확해질 수 있습니다.)
3. 톱날이 펜스에 대해 정확하게 수직인 경우, 네 개의 나사 46 를 풀고 마이터 눈금 17 을 유지하고 정사각형으로 측정된 대로 날이 펜스와 직각이 될 때까지 마이터 잠금 핸들과 눈금을 좌측 또는 우측으로 이동합니다.
4. 네 개의 나사를 다시 조입니다. 이 때에는 마이터 포인터 44 의 눈금값에 주의할 필요가 없습니다.

마이터 포인터 조정(그림 H)

1. 마이터 잠금 핸들 19 의 잠금을 풀어 마이터 암을 0 위치까지 이동합니다.
2. 마이터 잠금 핸들의 잠금을 푼 상태에서, 마이터 암을 0으로 돌리면 마이터 래치가 제자리에서 딸깍하고 잠깁니다.
3. 그림 H와 같이 마이터 포인터 44 와 마이터 눈금 17 을 주시합니다. 포인터가 정확하게 0을 가리키지 않을 경우, 포인터를 제자리에 고정하고 있는 마이터 포인터 나사 45 를 풀고, 포인터의 위치를 다시 잡고 나사를 조입니다.

테이블에 직각이 되도록 베벨 조정 (그림 A1, A2, I, L)

1. 날이 테이블에 직각이 되도록 맞추려면 내려 잠금 핀 9 으로 암을 내린 위치에 잠깁니다.
2. 치 상단에서 직각이 되지 않도록 하면서 날에 직각이 되도록 놓으십시오(그림 L).
3. 베벨 잠금 노브 31 를 풀고 암이 0° 베벨 스톱 쪽에 단단히 있는지 확인하십시오.
4. 날이 테이블에서 0° 베벨에 있도록 필요에 따라 0° 베벨 조정 나사(54 그림 I)를 6 mm 육각 날 렌치 29 로 돌립니다.

베벨 포인터 조정(그림 I)

베벨 포인터 48 가 0을 가리키지 않을 경우, 각 베벨 포인터를 제자리에 고정하는 각 나사 47 를 풀고 필요에 따라 이동합니다. 다른 베벨 각도 나사를 조정하기 전에 0° 베벨이 정확하고 베벨 포인터가 설정되었는지 확인하십시오.

베벨 스톱 45° 우측 및 좌측 조정(그림 A2, I)

우측 45° 베벨 스톱을 조정하려면:

1. 베벨 잠금 노브 31 를 풀고 0° 베벨 스톱 오버라이드 32 을 당겨 0° 베벨 스톱을 오버라이드합니다.
2. 톱이 완전히 우측에 있을 때, 베벨 포인터 48 가 정확하게 45°를 가리키지 않을 경우 베벨 포인터가 45°를 가리킬 때까지 6 mm 육각 날 렌치 29 로 좌측 45° 베벨 조정 나사 53 를 돌립니다.

좌측 45° 베벨 스톱을 조정하려면:

- a. 베벨 잠금 노브를 풀고 헤드를 좌측으로 기울입니다.
- b. 베벨 포인터가 정확하게 45°를 가리키지 않을 경우, 베벨 포인터가 45°를 나타낼 때까지 우측 45° 베벨 조정 나사 54 를 돌립니다.

베벨 스톱을 22.5° (또는 30°)로 조정(그림 A2, I)

참고: 0° 베벨 각도와 베벨 포인터 조정을 수행한 후에만 베벨 각도를 조정하십시오.

좌측 22.5° 베벨 각도를 설정하려면 좌측 22.5° 베벨 멈춤쇠 51 를 탁 돌립니다.

베벨 잠금 노브 31 를 풀고 헤드를 좌측으로 완전히 기울입니다. 베벨 포인터 48 가 정확하게 22.5°를 가리키지 않을 경우, 베벨 포인터가 22.5°를 나타낼 때까지 10 mm 렌치로 멈춤쇠와 맞닿는 크라운 조정 나사 49 를 돌립니다.

우측 22.5° 베벨각을 조정하려면 우측 22.5° 베벨 멈춤쇠를 탁 돌립니다. 베벨 잠금 노브를 풀고 0° 베벨 스톱 32 을 당겨 0° 베벨 스톱을 오버라이드합니다. 톱이 완전히 우측에 있을 때, 베벨 포인터가 정확하게 22.5°를 가리키지 않을 경우 베벨 포인터가 정확하게 22.5°를 가리킬 때까지 10 mm 렌치로 멈춤쇠와 맞닿아 있는 크라운 조정 나사 49 를 돌립니다.

펜스 조정(그림 A1)

펜스의 상부를 조정해서 톱이 49° 좌측 및 우측으로 베벨링할 수 있도록 클리어런스를 제공할 수 있습니다.

1. 각 펜스 11 를 조정하려면, 펜스 조정 노브 10 를 풀고 펜스를 바깥쪽으로 밀니다.
2. 톱의 스위치를 끈 채 공회전을 시키고 유격을 확인하십시오.
3. 암이 위아래 이동을 방해하지 않으면서 최대한 작업물을 지지하도록 펜스를 최대한 실용적으로 날에 가깝게 조정합니다.
4. 펜스 조정 노브를 단단히 조입니다.
5. 베벨 작업이 완료되면 펜스를 이동합니다.

일부 절단의 경우 펜스를 날에 더 가까이 놓는 것이 바람직할 수 있습니다. 그렇게 하려면 펜스 조정 노브 10 를 풀고 펜스를 정상 제한을 지나 날에 더 가까이로 민 다음 펜스 조정 노브를 조입니다. 먼저 시운전 해보고 날이 펜스와 닿지 않는지 확인하십시오.

일부 절단의 경우 슬라이딩 펜스를 제거하는 것이 바람직할 수 있습니다. 그렇게 하려면, 펜스 조정 노브 10 를 풀고 펜스를 베이스 펜스에서 완전히 벗어나도록 밀니다. 절단이 완료되면, 슬라이딩 펜스를 교체하십시오.

참고: 펜스 트랙이 톱밥으로 막힐 수 있습니다. 브러시나 약한 저압의 공기를 사용해 가이드 홈을 청소하십시오.

가드 작동 및 시계(그림 X)

톱의 하부 가드 1 는 암이 내려가면 자동으로 날의 덮개를 벗기고 암이 올라가면 날을 덮도록 설계되었습니다.

톱날을 설치 또는 분리하거나, 톱 점검 시 손으로 가드를 올릴 수 있습니다. 날이 정지되지 않았을 때는 하부 가드를 수동으로 올리지 마십시오.

레일 가이드 조정(그림 A1)

정기적으로 레일 7 의 동작과 톱을 점검합니다.

고정나사 5 로 우측 레일을 조정할 수 있습니다. 톱을 줄이려면 톱 헤드를 앞뒤로 밀면서 4 mm 육각 렌치를 사용해 고정나사를 서서히 시계 방향으로 돌립니다.

마이터 잠금 조정(그림 A1, M)

마이터 잠금 핸들이 아래로 잠겨 있을 때 톱의 테이블이 움직일 수 있는 경우 마이터 잠금 봉 55 을 조정해야 합니다.

1. 마이터 잠금 핸들 19 을 잠금 해제(위쪽) 위치로 놓습니다.
2. 13 mm 오픈 엔드 렌치를 사용해 마이터 잠금 봉의 잠금 너트 56 를 풀니다.

1. 일자형 나사를 사용해 그림 M과 같이 시계 방향으로 돌려 마이터 잠금봉을 조입니다. 꼭 맞을 때까지 잠금봉을 돌린 다음 시계 반대 방향을 한 차례 돌립니다.
2. 마이터 눈금에서 비 멈춤 측정치(예, 34°)까지 마이터 잠금을 다시 잠그고 테이블이 돌아가지 않는지 확인하십시오.
3. 잠금 너트를 조입니다.

작동을 하기 전에

- 톱 베이스의 양쪽에 베이스 연장부를 설치합니다. **베이스 연장부 조립** 섹션을 참조하십시오.
- 보호 벨트 커버의 손상 여부와 하부 가드가 제대로 기능하는지 확인하십시오.
- 반드시 절단판을 사용하십시오. 쉐 자극의 구멍이 12 mm보다 더 넓을 경우 기계를 작동하지 마십시오.
- 적절한 톱날을 설치하십시오. 지나치게 마모된 날을 사용하지 마십시오. 공구의 최대 회전 속도는 톱날의 최대 회전 속도를 초과해서는 안 됩니다.
- 모든 잠금 노브와 클램프 핸들이 조여졌는지 확인하십시오.
- 신체 보호 장비를 착용하고 톱을 외부 집진기에 연결합니다.
- 이 톱은 나무와 여러 비철금속을 절단할 것이지만, 이 작동 지침은 나무 절단만을 참조할 것입니다. 다른 재료에도 동일한 가이드라인이 적용됩니다. 철계(철 및 강) 재료 또는 석조를 이 톱으로 절단하지 마십시오!
- 지나치게 작은 조각을 절단하려고 하지 마십시오.
- 작업물을 고정하십시오.
- 날이 자유재로 절단할 수 있어야 합니다. 무리하게 힘을 가하지 마십시오.
- 절단 전에 모터가 최대 속도에 도달할 수 있어야 합니다.

조작

사용 지침

! **경고:** 안전 지시 사항과 해당 규정을 항상 준수하십시오.

! **경고:** 액세서리를 설치 및 제거하기 전, 구성 상태를 조정하거나 변경하기 전, 또는 수리 시 부상의 위험을 줄이려면 장치를 끄고 전원에서부터 연결을 차단하십시오. 트리거 스위치가 꺼짐 위치에 있는지 반드시 확인하십시오. 공구가 갑자기 작동하여 부상을 당할 수 있습니다.

선택 액세서리 섹션의 톱날을 참조해서 가장 적합한 날을 선택합니다.

작업대 높이와 안정성 면에서 공구가 인체공학적 조건을 충족시키는 위치에 놓여 있는지 확인하십시오. 어떠한 제약 사항 없이 작업물을 취급할 수 있도록 작업자가 전체적으로 잘 볼 수 있고 기계 주변에 충분한 여유로운 공간이 있도록 기계 위치를 선택해야 합니다.

진동의 영향을 줄이려면 주변 온도가 너무 춥지 않고, 기계와 액세서리를 충분히 유지 보수하였고 작업물 크기가 이 기계에 적합인지 확인하십시오.

코드가 작업을 방해하지 않도록 하십시오.

올바른 몸과 손의 위치(그림 N1, N2)

! **경고:** 심각한 신체 부상의 위험을 줄이려면 **항상** 그림 N1과 같이 올바른 자세를 취하십시오.

! **경고:** 심각한 신체 부상의 위험을 줄이려면, **항상** 급작스러운 반동을 예상하고 확실하게 잡으십시오.

- 절대로 절단되는 부위에 손을 두지 마십시오. 손은 날로부터 100mm 보다 더 가까이에 두지 마십시오.
- 절단 시 테이블과 펜스에 대해 작업물을 단단히 잡으십시오 작동이 풀리고 톱날이 완전히 멈출 때까지 손을 제자리에 유지하십시오.
- 항상 날의 방향을 확인할 수 있도록 절단을 끝마치기 전에 시운전을 해 보십시오 (전원을 공급하지 않은 상태에서). 그림 N2와 같이 손을 교차하지 마십시오.
- 양쪽 발을 바닥에 단단히 고정하고 적절한 균형을 유지하십시오. 마이터 암이 좌우로 움직이므로 따라가듯 톱날의 측면에서 약간 옆으로 서 있으십시오.
- 연필선을 따라갈 때는 가드 루버를 통해 찾으십시오.

트리거 스위치(그림 A2)

톱을 켜려면 락오프 레버 **23** 를 공구 왼쪽으로 민 다음 트리거 스위치 **22** 를 누르십시오. 스위치가 눌러 있는 동안 톱이 작동합니다. 절단을 하기 전에 날이 최대 작동속도로 돌아가길 수 있도록 합니다. 톱을 끄려면 스위치를 놓습니다. 톱 헤드를

올리기 전에 톱날이 정지하도록 합니다. 스위치를 잠그는 방법은 존재하지 않습니다. 스위치의 잠금을 해제하는 자동쇠를 끼울 수 있도록 트리거 트리거에 구멍 **24** 이 나 있습니다.

톱에는 자동 전자 날 브레이크가 장착되어 있지 않지만 톱날은 트리거를 놓은 후 10 초 이내에 멈추어야 합니다. 이는 조절할 수 없습니다. 정지 시간이 반복해서 10초를 초과하는 경우, 공구를 공인 DeWALT 서비스 센터에 보내 수리를 받으십시오. 항상 절단 부위에서 제거하기 전에 날이 정지했는지 확인하십시오.

먼지 배출(그림 A2, C)

! **경고:**오크 또는 너도밤나무 먼지 등 특정 먼지는 특히 목재 처리 첨가제와 연결되어 발암성으로 간주됩니다.

- 항상 먼지 배출 기능을 사용하십시오.
- 작업장의 환기가 잘 되도록 하십시오.
- 적절한 마스크를 착용하는 것이 좋습니다.

톱에는 내장 먼지 포트 **33** 가 있어서 먼지주머니 **36** 또는 매장용 진공 장치를 연결할 수 있습니다.

먼지주머니를 장착하려면

1. 먼지주머니 **36** 를 먼지 포트 **33** 에 장착합니다.

먼지주머니를 비우려면

1. 톱에서 먼지주머니 **36** 를 분리한 다음 먼지주머니를 살짝 흔들거나 두드려서 먼지를 비웁니다.
2. 먼지주머니를 다시 먼지 포트 **33** 에 재장착합니다.

모든 먼지가 주머니에서 완전히 떨어지지 않을 수 있습니다. 이는 절단 성능에 영향을 주지 않지만 톱의 집진 효율성을 감소시킵니다. 톱의 집진 효율성을 회복시키려면, 비우고 쓰레기통 또는 먼지통의 측면에 대고 털 때 먼지주머니 안쪽의 스프링을 누릅니다.

! **주의:** 먼지 주머니 또는 DeWALT 먼지 제거기가 제자리에 없을 때는 절대로 이 톱을 작동하지 마십시오. 나무 먼지는 호흡 관련 위험을 야기할 수 있습니다.

XPS LED 작업등 장치 사용(그림 A1, A2)

참고: 마이터 썬기 전원 장치에 연결되어 있어야 합니다.

XPS LED 작업등 장치에는 on/off 스위치 **25** 가 장착되어 있습니다. XPS LED 작업등 장치는 마이터 스위드 트리거 스위치와 독립되어 있습니다. 톱을 작동하기 위해서 작업등을 켤 필요는 없습니다.

나무 조각에 있는 기존의 연필선을 따라 절단하려면:

1. XPS 장치를 켜 다음, 작동 핸들 **2** 을 아래로 당겨서 톱날이 나무 가까이에 가도록 합니다. 나무에 날의 그림자가 나타납니다.
2. 연필 선을 날의 그림자 가장자리에 맞춥니다. 연필선을 정확하게 맞추려면 마이터 또는 베벨 각도를 조정해야 할 수 있습니다.

스루 커팅 작업(그림 A1, A2, O, P)

슬라이드 기능을 사용하지 않는 경우 톱 헤드가 최대한 멀리 뒤로 밀려졌고 레일 잠금 노브 **4** 가 조여졌는지 확인하십시오. 이는 작업물이 작동됨에 따라 톱이 레일에 따라 미끄러지지 않도록 방지합니다.

여러 개의 조각을 한 번에 절단하는 것은 권장되지 않으나 각 조각이 작업대와 펜스에 단단히 고정되어 있으면 가능합니다.

일직선 수직 크로스컷

1. 마이터 암을 0에 설정하여 잠그고 나무를 테이블 **15** 과 펜스 **11** 에 단단히 고정합니다.
2. 레일 잠금 노브 **4** 를 쥘 상태에서 트리거 스위치 **22** 를 당겨서 톱을 켭니다.
3. 톱의 속도가 올라가면 암을 천천히 부드럽게 내려 나무를 절단합니다. 암을 올리기 전에 날이 끝까지 나오도록 하십시오.

슬라이딩 크로스컷(그림 O)

51 x 150 mm (51 x 105 mm, 45° 마이터에서) 작업물보다 더 큰 어떤 것을 절단할 때, 레일 잠금 노브 **4** 를 쥘 상태에서 바깥쪽-아래쪽-뒤쪽 모션을 사용하십시오. 톱을 사용 후 쪽으로 당겨 빼고, 작업물 쪽으로 톱 헤드를 아래로 내리고 톱을 천천히 뒤로 밀어 절단을 완료합니다.

베 내는 동안 톱이 작업물의 상부와 접촉하지 않도록 하십시오. 톱이 사용자 쪽으로 돌아서 부상을 입거나 작업물이 손상될 수 있습니다.

마이터 크로스컷(그림 P)

모서리를 만들 때 마이터 각도는 대개 45°이지만 0에서 50° 좌측 또는 60° 우측으로 모든 곳으로 설정할 수 있습니다. 일직선 수직 크로스컷을 진행합니다.

51 x 105 mm 보다 더 넓고 길이는 더 짧은 작업물에서 마이터 절단을 할 때는 항상 긴 쪽을 펜스쪽에 두십시오.

베벨 절단(그림 A1, A2)

베벨 각도는 49° 우측에서 49° 좌측까지 설정할 수 있고 50° 좌측 또는 60° 우측 사이로 설정한 마이터 암으로 절단할 수 있습니다. 베벨 시스템에 대한 자세한 설명은 **기능 및 키톨** 섹션을 참조하십시오.

1. 베벨 잠금 노브 **31** 을 풀고 톱을 원하는 대로 좌측 또는 우측으로 이동합니다. 간격을 허용하려면 펜스 **11** 를 이동해야 합니다. 펜스의 위치를 정한 후에는 펜스 조정 노브 **10** 를 조입니다.
2. 베벨 잠금을 단단히 조입니다.

일부 각도에서는 우측 또는 좌측의 펜스를 제거해야 할 수도 있습니다. 일부 베벨 절단의 경우 펜스 조정에 대한 중요한 정보는 **조정** 섹션에서 **펜스 조정**을 참조하십시오.

좌측 또는 우측의 펜스를 제거하려면 펜스 조정 노브 **10** 를 여러 번 돌려 나사를 풀고 펜스를 밀어 뺍니다.

베벨 작업이 완료되면 펜스의 위치를 다시 잡습니다.

절단 품질

모든 절단물의 매끄러움은 절단되는 재료, 날 종류, 날의 날카로움과 절단 속도 등 다양한 변수에 따라 달라집니다.

물딩 및 기타 정교한 작업을 위해 가장 매끄러운 절단물을 원할 경우, 날카로운 (60 치 카비트) 날과 더 느리고 고른 절단 속도가 원하는 결과를 만들 것입니다.

! **경고:** 절단 중 재료가 이동하거나 천천히 움직이지 않도록 제자리에 단단히 고정하십시오. 항상 암을 올리기 전에 날이 끝까지 나오도록 하십시오. 나무의 작은 섬유 조직이 작업물의 뒤쪽에 쏟아지는 경우, 절단할 나무에 보호 테이프를 붙이십시오. 테이프를 통과해 톱질을 하고 끝난 후에는 테이프를 조심스럽게 제거합니다.

비 스루 커팅(그루빙 및 은축이음)

톱에는 그루빙 스톱 **28**, 깊이 조정 나사 **27** 와 워 너트 **26** 가 있어 홈 절단을 할 수 있습니다. **크로스컷, 베벨 절단 및 컴파운드 마이터 절단** 섹션의 지시 사항은 재료의 전 단계를 통해 만드는 절단에 대한 것입니다. 또한 재료에 홈이나 은축이음을 만드는 데 비 스루 커팅을 수행할 수도 있습니다.

그루빙(그림 A1, A2)

절삭 깊이 설정에 대한 자세한 설명은 **그루빙 스톱**을 참조하십시오. 목재 조각은 원하는 절삭 깊이를 확인하는 데 사용해야 합니다.

1. 나무를 테이블과 펜스 **11** 에 단단히 고정하십시오. 날 아래에서 절단 영역을 조정합니다. 날을 내린 위치에 둔 상태에서 톱 암을 완전히 앞쪽으로 위치를 정합니다. 그림 A2와 같이 트리거 스위치 **22** 를 돌려 톱을 켭니다. 부드럽게, 톱 암을 뒤쪽으로 밀어서 작업물을 관통해 홈을 절단합니다.
2. 톱 암을 내린 상태에서 트리거 스위치를 놓습니다. 톱날이 완전히 정지하면, 톱 암을 올립니다. 항상 암을 올리기 전에 날이 끝까지 나오도록 하십시오.
3. 홈을 넓히려면, 원하는 너비가 될 때까지 1-2 단계를 반복합니다.

작업물 고정하기(그림 B)

! **경고:** 절단 전에 고정하여 균형을 맞춘 작업물은 절단을 완료한 후에 균형을 잃을 수 있습니다. 불균형 하중은 테이블이나 작업대 등 톱이 부착되어 있는 어떤 것이나 톱을 기울여지게 할 수 있습니다. 균형을 잃을 수 있는 절단을 할 때는 작업물을 제대로 지지하고 톱이 안정된 표면에 볼트로 단단히 고정했는지 확인하십시오. 부상을 입을 수 있습니다.

! **경고:** 클램프를 사용할 때마다 클램프 끝은 톱의 베이스 위로 고정되도록 유지해야 합니다. 항상 작업물을 작업 영역의 다른 부분이 아닌, 톱의 베이스에 고정하십시오. 클램프 끝이 톱의 베이스 가장자리에 고정되지 않았는지 확인하십시오.

! **주의:** 항상 작업 클램프를 사용하여 제어를 유지하고 작업물의 손상과 부상의 위험을 줄이십시오.

톱과 함께 제공된 작업을 고정대 **35** 를 사용하십시오. 고정을 보조하기 위해 좌측 또는 우측 펜스가 좌우로 미끄러집니다. 작업물의 크기와 모양에 따라 스프링 클램프, 바 클램프 또는 C-클램프 등을 적절하게 보조적으로 사용할 수 있습니다.

클램프를 설치하려면

1. 펜스 뒤의 구멍에 클램프를 끼웁니다. 클램프는 마이터 슁 뒤쪽을 향해야 합니다. 클램프 봉의 홈이 베이스에 완전히 들어가야 합니다. 이 홈이 마이터 슁의 베이스에 완전히 삽입되었는지 확인하십시오. 홈이 보이는 경우, 클램프가 안정되지 않습니다.
2. 클램프를 마이터 슁 앞쪽으로 180° 돌립니다.
3. 노브를 풀어서 클램프를 위아래로 조정한 다음 미세 조정 노브를 사용해서 작업물을 단단히 조입니다.

참고: 베벨 절단 시 클램프를 베이스의 맞은편에 놓습니다. 항상 날의 경로를 확인할 수 있도록 절단을 끝내기 전에 시운전(전원을 공급하지 않은 상태에서)을 해 보십시오. 클램프가 톱이나 가드의 동작을 간섭하지 않도록 하십시오.

긴 조각용 지지대(그림 D)

항상 긴 조각으로 지지합니다.

최상의 결과를 위해 DE7023-XJ 또는 DE7033 레그 스탠드 **37** 를 사용해서 톱의 테이블 너비를 연장하십시오. 톱질모양 또는 유사한 장치 등의 편리한 수단을 사용하여 긴 작업물을 지지해 끝 쪽이 떨어지지 않도록 하십시오.

사진 액자, 새도박스 및 기타 4면체 절단하기 (그림 Q, R)

톱에 대한 "감각"이 개발될 때까지 나무 조각을 사용해서 간단한 프로젝트를 몇 가지 시도해 보십시오. 본 톱은 그림 Q에서 보는 것과 같이 모서리 마이터링을 위해 완벽한 공구입니다.

그림 R의 스케치 1은 베벨 조정 방식으로 만든 이음부를 나타냅니다. 그림과 같은 이음부는 두 개의 방법 중 하나를 사용해 만들 수 있습니다.

- 베벨 조정 가능 사용:
 - 두 개의 보드용 베벨은 각각 45°로 조정되어 90° 모서리를 만든 것입니다.
 - 마이터 암은 0 위치에서 잠겨 있고 베벨 조정은 45°에 잠겨 있습니다.
 - 보드의 평평한 쪽을 테이블에 맞대어 두고 좁은 가장자리는 펜스 쪽으로 나무를 놓습니다.
- 마이터 조정 가능 사용:
 - 동일한 절단은 보드 면을 펜스 쪽으로 둔 상태에서 좌우로 마이터링하여 할 수 있습니다.

트림 물딩 및 기타 프레임 절단(그림 R)

그림 R의 스케치 2는 90°의 모서리를 형성하는 두 개의 보드를 마이터링하기 위해 마이터 암을 45°로 설정해 만든 이음부입니다. 이러한 이음부 유형을 만들려면 베벨 조정을 0으로 설정하고 마이터 암을 45°로 설정합니다. 다시 한 번 보드의 평평한 쪽을 테이블에 두고 좁은 가장자리는 펜스 쪽으로 나무를 놓습니다.

그림 R에서 두 개의 스케치는 4면체 전용입니다. 먼 수가 변경됨에 따라 마이터 및 베벨 각도를 변경하십시오. 아래의 차트는 모든 면이 동일한 길이라는 가정하에 다양한 모양에 대한 적절한 각도를 제공하고 있습니다.

면 수	마이터 또는 베벨 각도
4	45°
5	36°
6	30°
7	25.7°
8	22.5°
9	20°
10	18°

차트에 표시되지 않은 모양의 경우 다음 공식을 사용하십시오. 마이터(재료가 수직으로 절단되는 경우) 또는 베벨 각도(재료가 평평하게 놓인 상태로 절단되는 경우) 동일한 면 수로 180° 분할됨.


컴파운드 마이터 절단(그림 S)

컴파운드 마이터는 마이터 각도와 베벨 각도를 동시에 사용해 만든 절단입니다. 이는 그림 S와 같이 비스듬한 면이 있는 프레임 또는 상자를 만들 때 사용되는 절단 유형입니다.

! **경고: 절단 각도가 절단마다 다를 경우, 베벨 잠금 노브와 마이터 잠금 핸들이 확실하게 잠겨있는지 확인하십시오. 이러한 것들은 베벨 또는 마이터에서 변경한 후 반드시 잠겨 있어야 합니다.**

아래의 차트는 일반적인 컴파운드 마이터 절단을 위해 적합한 베벨 및 마이터 설정을 선택하는 데 도움을 줄 것입니다.

- 프로젝트의 원하는 각도 A(그림 S)를 선택하고 차트에서 적절한 호에 해당하는 각도를 찾습니다.
- 해당 지점에서 차트를 곧장 아래를 훑어 정확한 베벨 각도를 찾고 곧장 가로질러 정확한 마이터 각도를 찾습니다.
- 톱을 미리 정한 각도에 놓고 몇 번 시험 절단을 해 봅니다. 절단 조각을 서로 맞춰 보십시오.

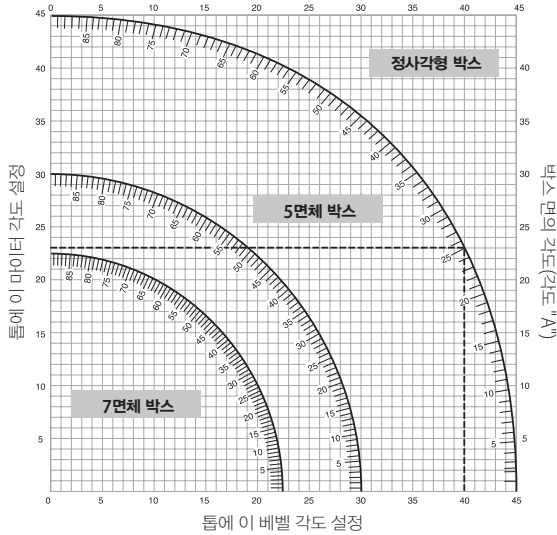

예: 26° 외각이 있는 4면체 박스를 만들려면(각도 A, 그림 S), 상부의 오른쪽 호를 사용합니다. 호 눈금에서 26°를 찾습니다. 톱의 마이터 각도(42°)를 설정하려면 양쪽 중 한쪽으로 수평 교차선을 따라갑니다. 마찬가지로, 톱에 베벨 각도(18°)를 설정하려면 위 또는 아래로 수직 교차선을 따라갑니다. 항상 나무의 몇 개 파편 조각을 절단해 보고 톱의 설정을 확인하십시오.

베이스 몰딩 절단(그림 J, T)

직각 90° 절단을 완료하려면, 나무를 펜스 쪽으로 놓고 그림 T와 같이 제자리에 고정합니다. 톱을 켜고 날이 최대 속도에 도달하도록 하고 절단하면서 암을 매끄럽게 내립니다.

펜스에 대해 수직으로 76 mm부터 최고 171 mm까지 베이스 몰딩 절단(그림 J, T)

참고: 펜스 쪽으로 수직이 되게 76 mm ~ 171 mm까지 측정하는 베이스 몰딩 절단 시 그림 J와 같이 슬라이드 잠금 레버 **57** 를 사용합니다.

그림 T와 같이 재료를 놓으십시오.

몰딩이 뒤쪽의 펜스 쪽에 있고 몰딩의 아래 부분이 테이블 쪽에 있는 상태에서 모든 절단을 해야 합니다.

	안쪽 모서리	바깥쪽 모서리
좌측	마이터 좌측 45° 절단면의 좌측 보관	마이터 우측 45° 절단면의 좌측 보관
우측	마이터 우측 45° 절단면의 우측 보관	마이터 좌측 45° 절단면의 좌측 보관

최대 171 mm까지의 재료는 위에 설명한 대로 절단할 수 있습니다.

크라운 몰딩 절단(그림 A1, U1, U2)

마이터 쓰는 크라운 몰딩 절단 작업에 아주 적합합니다. 제대로 맞추려면 크라운 몰딩을 최대한 정확한 상태로 컴파운드 마이터링을 해야 합니다.

본 마이터 쓰는 33.86° 좌우측에서 적합한 각도와 베벨 스톱 멈춤쇠에서 크라운 몰딩 절단을 위해 31.62° 좌우측에 특수한 사전설정 래치 지점이 있습니다. 또한 33.9°에 베벨 눈금 **8** 이 표시되어 있습니다. 아래의 차트는 크라운 몰딩 절단을 위해 적합한 설정입니다.

참고: 조각 재료로 사전 테스트를 하는 것이 대단히 중요합니다!

컴파운드 기능을 사용하여 평평한 곳에 놓고 크라운 몰딩 절단을 위한 지침(그림 U1)

- 몰딩은 보드 뒤쪽 면을 톱날 **15** 의 아래쪽에 둔 상태에서 평평하게 놓아야 합니다.
- 몰딩의 위쪽을 펜스 **11** 쪽에 놓습니다.
- 아래의 설정은 45° 옹수철이 달린 크라운 몰딩을 위한 것입니다.

	안쪽 모서리	바깥쪽 모서리
좌측	베벨 좌측 30° 우측 35.26°의 마이터 테이블 설정 절단면의 좌측 끝 보관	베벨 우측 30° 좌측 35.26°의 마이터 테이블 설정 절단면의 좌측 끝 보관
우측	베벨 우측 30° 좌측 35.26°의 마이터 테이블 설정 절단면의 우측 끝 보관	베벨 좌측 30° 우측 35.26°의 마이터 테이블 설정 절단면의 우측 끝 보관

- 아래의 설정은 상단 52° 각도와 하단 38° 각도의 크라운 몰딩을 위한 것입니다.

	안쪽 모서리	바깥쪽 모서리
좌측	베벨 좌측 33.9° 우측 31.62°의 마이터 테이블 설정 절단면의 좌측 끝 보관	베벨 우측 33.9° 좌측 31.62°의 마이터 테이블 설정 절단면의 좌측 끝 보관
우측	베벨 우측 33.9° 좌측 31.62°의 마이터 테이블 설정 절단면의 우측 끝 보관	베벨 좌측 33.9° 우측 31.62°의 마이터 테이블 설정 절단면의 우측 끝 보관

크라운 몰딩 절단을 위한 대체 방법

이 방법을 사용한 크라운 몰딩 절단은 베벨 절단이 필요하지 않습니다. 마이터 각도에서의 극미한 변경은 베벨 각도에 영향을 주지 않고 할 수 있습니다. 90° 이외의 모서리를 만났을 때 톱을 빠르고 쉽게 조정할 수 있습니다.

모든 절단용으로 톱의 펜스와 베이스 간 각도를 맞춘 크라운 몰딩 절단을 위한 지침 사항(그림 U2)

- 몰딩의 하부(설치 시 벽 쪽으로 가는 부분)가 펜스 **11** 쪽에 있고 몰딩의 상부가 톱 테이블 **15** 에 있도록 몰딩의 각도를 맞춥니다.
- 몰딩 뒤쪽에 각이 있는 "플랫"은 펜스와 톱 테이블에 똑바로 놓여 있어야 합니다.

	안쪽 모서리	바깥쪽 모서리
좌측	마이터 우측 45° 절단면의 우측 보관	마이터 좌측 45° 절단면의 우측 보관
우측	마이터 좌측 45° 절단면의 좌측 보관	마이터 우측 45° 절단면의 좌측 보관

특수 절단

! **경고: 재료가 테이블과 펜스에 대해 고정되지 않을 경우 절대로 절단하지 마십시오.**

알루미늄 절단(그림 V1, V2)

항상 알루미늄 절단을 위해 특별히 제작된 톱날을 사용하십시오.

특정 작업물의 경우 절단 중 움직임을 방지하기 위해 집쇠 또는 고정 장치를 사용해야 할 수 있습니다. 그림 V1에서와 같이 가장 얇은 단면도를 절단할 수 있도록 재료의 위치를 정합니다. 그림 V2는 이러한 돌출된 부분을 절단하는 잘못된 방법을 보여주고 있습니다.

알루미늄 절단 시 스틱 왁스 절단 윤활유를 사용하십시오. 절단하기 전에 톱날 **42** 에 직접 스틱 왁스를 바르십시오. 절대로 움직이는 날에 스틱 왁스를 바르지 마십시오. 왁스는 적절한 윤활 기능을 제공하고 파편이 날에 들러붙지 않도록 해줍니다.

굵은 재료(그림 W1, W2)

굵은 재료를 절단할 때는 항상 그림 W1과 같이 위치를 정하고 그림 W2와 같이 절대로 하지 마십시오. 재료의 위치를 잘못 잡으면 날이 깨질 수 있습니다.

플라스틱 파이프 또는 기타 둥근 재료 절단

플라스틱 파이프는 톱으로 쉽게 절단할 수 있습니다. 목재와 같이 절단되고 **굴러가지 않도록 렌스에 단단히 필스로 고정하거나 받쳐져야 합니다.** 이는 각도 절단물을 만들 때 매우 중요합니다.

대형 재료 절단(그림 X)

때때로 하부 가드 아래에 맞추기에 너무 큰 나무 조각을 만날 때가 있을 것입니다. 이러한 경우, 그림 Y와 같이 작업물을 알아 볼 수 있도록 가드 1의 상부 쪽에 우측 엄지손가락을 놓고 가드를 위로 올립니다. 가능한 한 이렇게 하지 말고, 필요할 경우 톱이 올바르게 작동하여 더 크게 절단을 할 수 있습니다. 이 톱을 작동할 때 절대로 뭉거나, 테이프를 감거나 가드를 열어 놓지 마십시오.

유지 보수

DEWALT 전동 공구는 최소한의 유지 보수로 장기간에 걸쳐 작업이 가능하도록 설계되어 있습니다. 만족스러운 연속 작동은 적절한 공구 관리와 정기적인 청소에 따라 그 성능이 달라질 수 있습니다.

경고: 액세서리를 설치 및 제거하기 전, 구성 상태를 조정하거나 변경하기 전, 또는 수리 시 부상의 위험을 줄이려면 장치를 끄고 전원으로부터 연결을 차단하십시오. 트리거 스위치가 꺼짐(OFF) 위치에 있는지 반드시 확인하십시오. 공구가 갑자기 작동하여 부상을 당할 수 있습니다.

경고: 심각한 부상의 위험을 줄이려면, 유지 보수를 수행하는 중에 손가락이나 손으로 톱날의 날카로운 지점을 만지지 마십시오.

플라스틱 가드 부근에서 윤활유 또는 클리너(특히 스프레이 또는 연무제)를 사용하지 마십시오. 가드에 사용된 폴리카보네이트 물질은 특정 화학물질에 의해 손상될 수 있습니다.



윤활방법

전동 공구는 별도의 윤활 작업이 필요하지 않습니다.



청소

사용하기 전에 상부 가드, 하부 가드 및 먼지 배관을 확인하여 올바르게 작동되는지 알아보십시오. 조각, 먼지 또는 작업을 입자가 기능 중 하나를 막고 있지 않은지 확인하십시오.

작업물의 파편이 톱날과 가드 사이에 끼인 경우에는 기계의 전원 공급을 차단하고 **새 톱날 교환 또는 설치** 섹션의 지침을 따르십시오. 움직이지 않는 부품을 제거하고 톱날을 재조립합니다.

주변, 베이스 아래 그리고 회전 테이بل 아래에서 먼지와 나무 조각을 정기적으로 청소하십시오.



경고: 톱공구 속이나 주변에 먼지가 쌓여있는 것이 보이면 가능한 한 자주 건조한 공기를 이용하여 메인 하우징에서 먼지를 불어내십시오. 이 절차를 수행할 때에는 승인된 눈 보호 장구 및 승인된 방진 마스크를 착용하십시오.



경고: 공구의 금속 이외의 부품을 청소할 때는 용제 등의 강력한 화학약품을 절대 사용하지 마십시오. 그렇지 않으면 이러한 부분에 사용된 재료가 약해질 수 있습니다. 형광에 물과 소량의 비누를 적셔 닦아주십시오. 공구 내부에 액체를 넣거나 공구 부품을 액체에 담그는 행동은 절대 금물입니다.

작업등 청소

- 면봉을 사용하여 작업등 렌즈에서 톱밥과 부스러기를 조심스럽게 닦으십시오. 먼지가 쌓이면 작업등을 차단하여 절단 선이 정확하게 표시되지 않을 수 있습니다.
- 어떤 종류의 용제도 사용하지 마십시오. 렌즈를 손상시킬 수 있습니다.
- 톱에서 날을 제거한 상태에서 날에 쌓인 파편을 청소하십시오.

먼지 배관 청소(그림 A1)

톱의 플러그를 뽑고 톱 헤드를 완전히 열린 상태에서, 저압 공기 또는 큰 직경의 정부축을 사용하여 먼지 배관 입구 18에서 먼지를 청소할 수 있습니다.

옵션 액세서리(그림 B-E)



경고: DEWALT에서 제공하지 않은 액세서리는 본 제품에서 테스트되지 않았으므로 본 제품에서 이러한 액세서리를 사용하면 위험할 수 있습니다. 신체 부상의 위험을 줄이려면 본 제품에 알맞은 액세서리만 사용해야 합니다.

톱날 설명

용도	직경	치
건축용 톱날(안티스틱 림으로 얇은 절단)		
일반 용도	305 mm	60
미세 크로스컷	305 mm	60
목공 톱날 (매끄럽고 깨끗한 절단면 제공)		
미세 크로스컷	305 mm	80
비철금속	305 mm	96

해당 액세서리에 대한 자세한 정보는 판매 대리점으로 문의하십시오.

환경 보호



분리 수거. 이 기호가 표시된 제품과 배터리를 일반 가정용 쓰레기와 함께 처리하면 안 됩니다.

제품과 배터리에는 재활용되거나 재활용되고 고철 자원에 대한 수요를 줄일 수 있는 자재가 포함되어 있습니다. 전기 제품과 배터리는 지역 규정에 따라 재활용하십시오. 자세한 내용은 www.2helpU.com에서 찾아 볼 수 있습니다.

